

Leadshine Technology Co., Ltd. (Headquarters)

Address: Floor 3, Building 2, Nanyou Tian'an Industrial Park, Nanshan District Shenzhen, China

Website: <http://www.leadshine.com>

Sales Hot Line:

Tel: 86-755-2641-7674 (for Asia, Australia, Africa region)

86-755-2640-9254 (for Europe region)

86-755-2641-7684 (for America region)

Fax: 86-755-2640-2718

Email: sales@leadshine.com

Technical Support:

Tel: 86-755-2641-8447

86-755-2641-8774

86-755-2647-1129

Fax: 86-755-2640-2718

Email: tech@leadshine.com and vic@leadshine.com



Leadshine

Leading Technology

Shining Value



Stepper Products

Smooth Movement, Extra Low Noise & Heating



Note: Product appearance and technical parameters are subject to change without notice.



Company Overview

Founded in 1997 by Warren Li, a MIT PhD graduate and former USA professor, Leadshine Technology Co., Ltd. is a leading technology company dedicated to design, manufacture, market, and support reliable and affordable motion control products based on the latest control technologies. Leadshine offers a full complement of products including motion controllers, control systems, servo drives & motors, integrated servos, easy servo drives & motors (closed loop steppers), integrated easy servo motors, stepper drives & motors, and integrated steppers. Today, Leadshine is one of the largest motion control companies in the world to provide solutions and quality products to tens of industries, and thousands of OEM clients in Asia, Europe, North & South America, Australia, and Africa.

Leadshine is committed to provide its customers with world-class motion control products at highly competitive prices. "LEADING technology and SHINING value" is always what Leadshine intends to offer.

R&D

Led by Dr. Warren Li, a PhD majoring in robotics & servo controls from MIT, Leadshine has one of the largest R&D teams in the motion control industry. That team consists of more than 100 R&D engineers. All of them are highly educated while most of them carry PhD & Master degrees in controls, electrical & electronics engineering, mechanical engineering, mechatronics, computer engineering, or computer science. Their strong background, experience & dedication make Leadshine capable of designing superior quality products of servos, steppers, controllers..., in the most efficient way based the latest technologies. Many innovative designs and products from Leadshine have been awarded patents, and helped our customers to design & build high quality machines in cost effective ways.

Product Quality

All products offered by Leadshine are at industrial quality and have proven records of successfully implemented in tens of industries by thousands of OEM clients in the world.

Leadshine has been ISO9001 certified for quality management practices since 2004. Our products are made of high quality materials, and produced by following rigorous manufacturing and quality control procedures. From supplier selection to raw material inspection, to manufacturing, to in-producuss quality control, and to final quality assurance, each process is strictly controlled to guarantee that every single Leadshine product will meet the pre-set tough quality standards. Most of our products are certified with CCC, CE, and UL/CUL.

Support and Service

Staffed with a highly professional and experienced application support team, Leadshine can help in the whole process of product development including initial application evaluation, product selection, design help & suggestion, and technical support. Our expertise and experience allow us to help OEM clients to produce competitive high quality machines in their industries. Leadshine can provide assistance and support services through email, telephone, and field support.

In addition, Leadshine also has a global distribution network consisting of local distributors that are highly experienced in the motion industry and understand their client application needs, to provide product selection support, system design assistance, sales & after-sales services, and technical support.



Stepper Products 2014/2015

Leading Technology

World-class Products at Highly Competitive Price



Currently, Leadshine offers three main series of 2-phase microstepping drives, the digital EM series, DM series and analog M series. The high performance DM drives are based on powerful 32-bit DSP control technology. Their features include super-low stepper noise, anti-resonance, low-speed ripple smoothing, and low motor heating. The EM series drives are leadshine's highest performance discrete stepper drives. They adopt even more innovative technologies than the DM series, thus have more features, such as sensorless stall detection, drive configuration protection, etc. The low-cost M drives employ precise analog current control and are characterized by extra high-speed torque, relatively low stepper noise and motor heating. Leadshine also supplies 3-phase digital and analog stepper drives.

Discrete Stepper Drives

Selection Guide	2
EM Series Digital Stepper Drives	4
EM402	4
EM503	4
EM705	4
EM806	4
DM Series Digital Stepper Drives	12
DM422C	12
DM556	12
DM870	12
DM1182	12
DM2282	12
3DM683	12
DM805-AI	12
MX Series Multi-axis Stepper Drives	19
MX3660	20
MX4660	21



Leadshine offers 2-phase and 3-phase stepper motors from NEMA frame size 14 to 51. Made of high quality cold roll sheet copper and anti-high temperature permanent magnet, Leadshine's stepper motors are highly reliable and generate low motor heating. Because of their nice internal damping characteristics, those stepper motors can run very smoothly and have no obvious resonance area within the whole speed ranges.

Stepper Motors

Selection Guide	24
2-phase Stepper Motors	
35 / 39 HSxx Series	26
42HSxx Series	27
57HSxx Series	28
86HSxx Series	29
110HSxx Series	30
130HSxx Series	31
3-phase Stepper Motors	
573Sxx Series	32
863Sxx Series	33
Speed-Torque Curves	34




Leadshine's iST series integrated stepper systems are one of the most compact stepper drive and motor package on the market. An iST integrated stepper has a stepper motor integrated with an advanced DSP based stepper drive. At very compact size and with all components integrated, the iST series steppers can save mounting space, and motor wiring time, increase reliability, and lower cable and labor cost.

Integrated Steppers

Selection Guide	36
iST Series	36
iST17	36
iST23	36
iST24	36

Basic Components of Motion Control System

Many different components are used in a variety of combinations to create a modern motion control system. Usually, the system will be comprised of the following basic elements: controller, drive/amplifier, actuator. And for a more integrated motion control system will be comprised of feedback, operator interface and host, besides elements mentioned above. A simplified block diagram of a motion control system would appear as shown below.

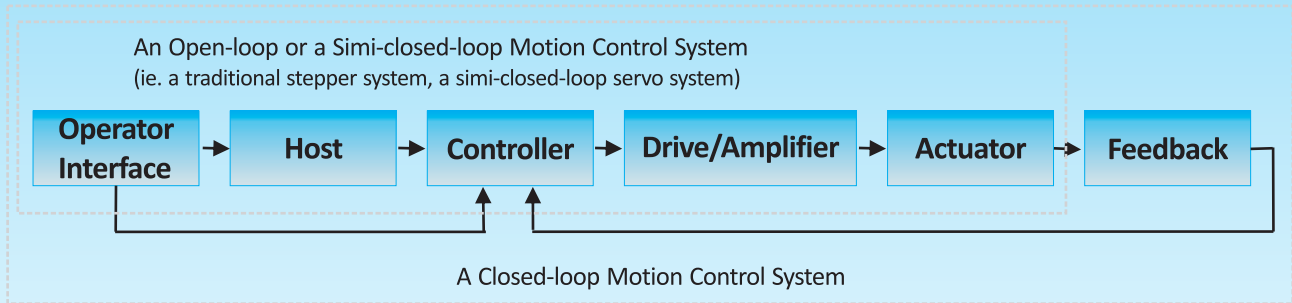

* Operator Interface and Host

Operator interface and host are/is present to input control logic, modify programs, or provide real time operations, such as system shut down or schedule changes.

* Controller

The controller acts as brain of the system by taking the desired target positions and motion profiles and creating the trajectories for the motors to follow. It will include a means of entering a set of instructions or code into its memory which are then translated into a series of electrical pulses or analog signals or network commands and output to a drive for controlling some type of actuator.

* Drive/Amplifier

The drive/amplifier receives the signals from the controller and generate the current required to drive or turn the actuator.



* Actuator

The actuator provides the actual physical motion and will be closely coupled to the design characteristics of the drive. The drive/actuator set may be any one of several different design classifications. Typically, but by no means always, they will the form of an electronic drive and an electric motor. Other common means of motion are pneumatic or hydraulic actuators.

* Feedback Device

There are a wide variety of feedback devices that are commonly used in motion control systems today which provide information on linear or rotary motion, such as optical encoders, magnetic encoders and resolvers.

A Typical Stepper System

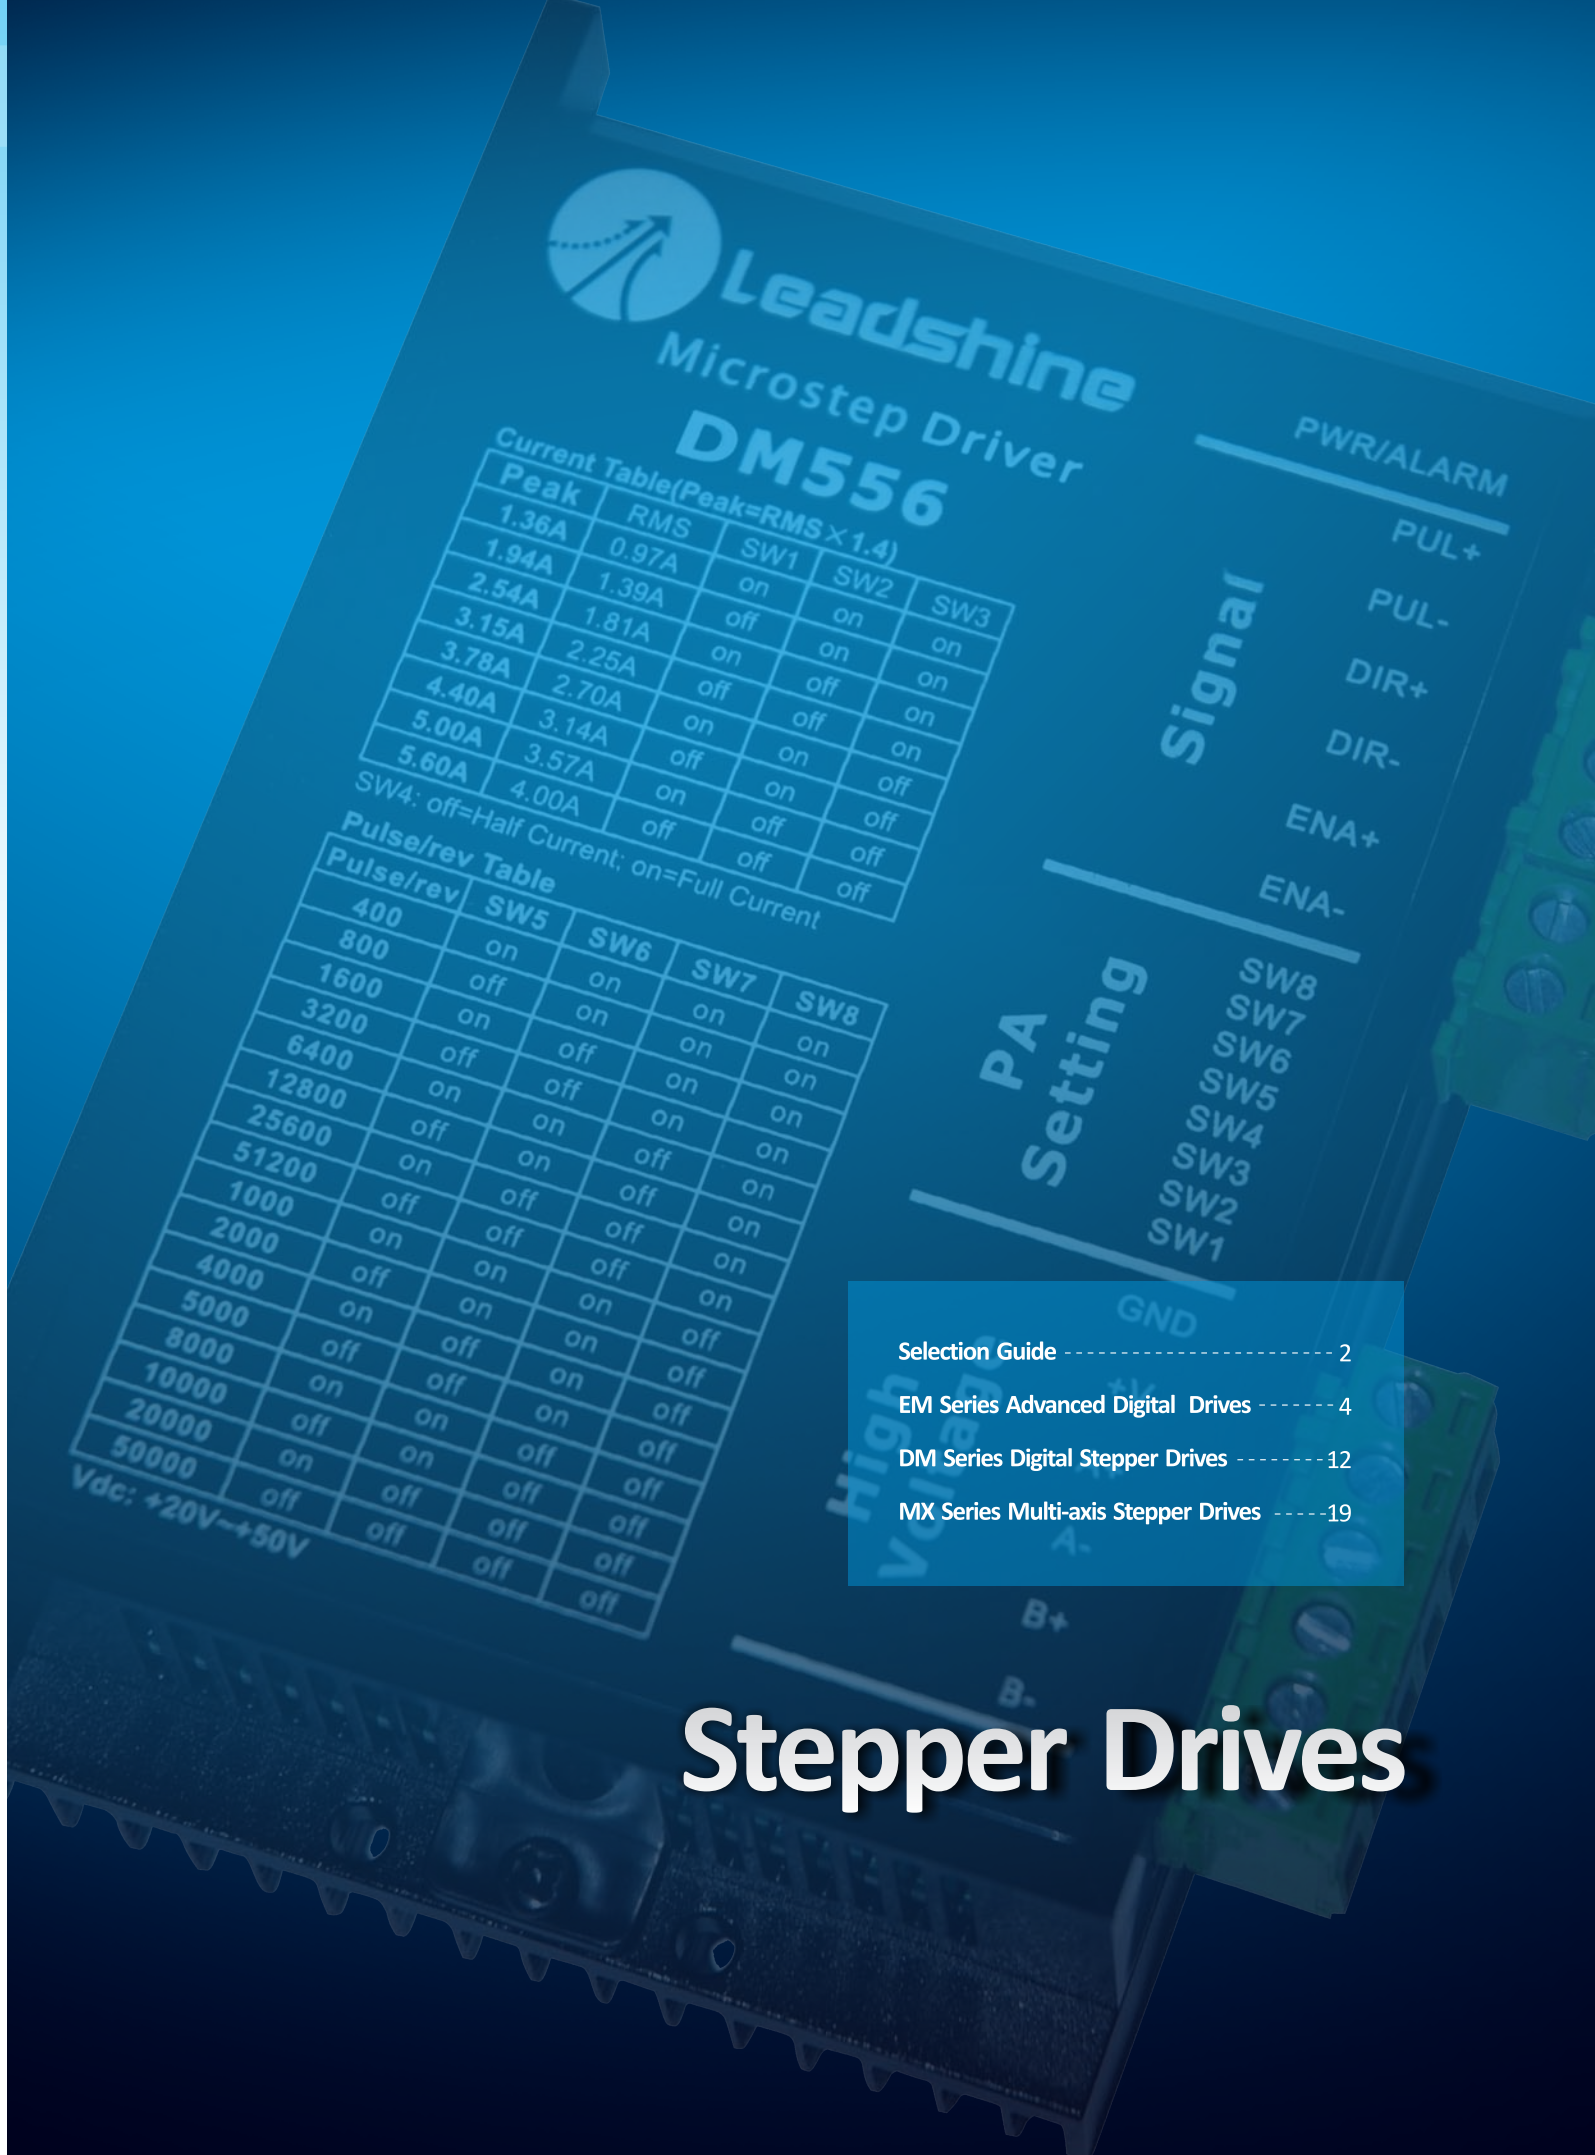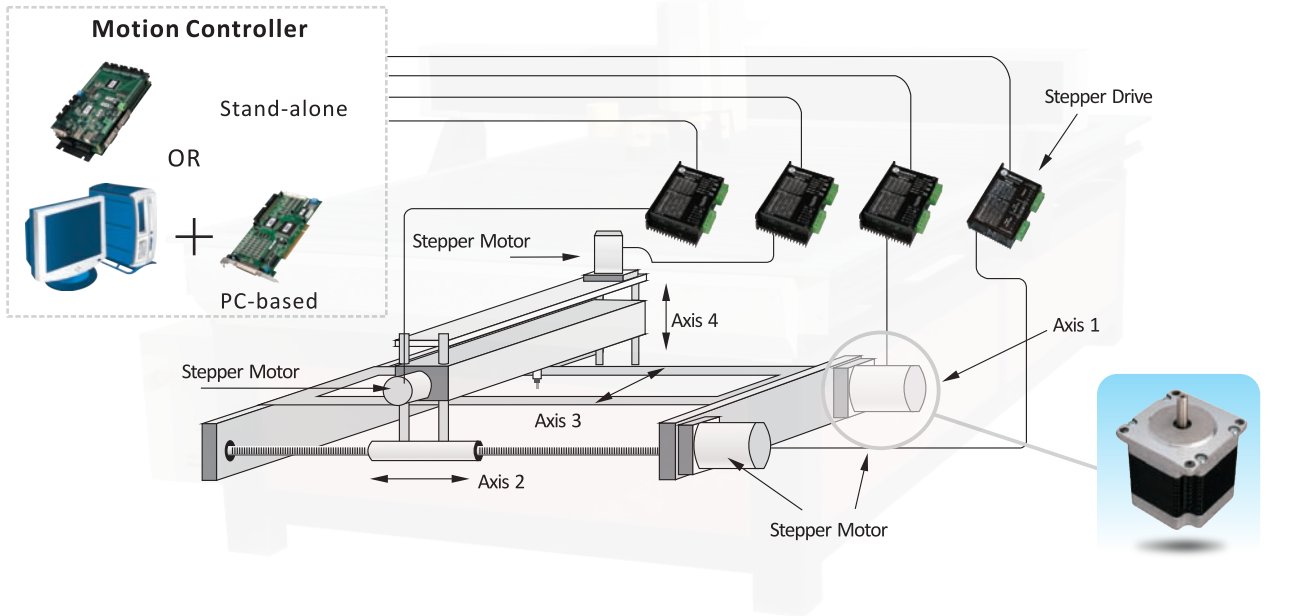


Selection Guide	2
EM Series Advanced Digital Drives	4
DM Series Digital Stepper Drives	12
MX Series Multi-axis Stepper Drives	19

Stepper Drives



Selection Guide for Stepper Drives

A stepper motor requires an electrical sequencer and it is called a stepper drive. The stepper drive is one of the key components in a stepper system. When you select a stepper drive for a specific application, you can follow the following steps. Firstly, you should choose the drive type and determine the drive operating mode. Secondly, choose right supply voltage and output current according with the application and motor. In the end, you should consider whether the acceptable control signals of the drive are right for those of your motion controller or not. Of course, the price of the chose drive should be acceptable too.

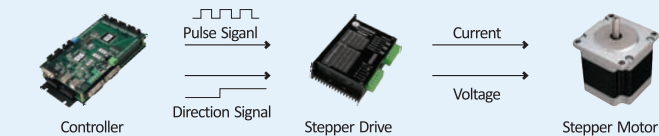

Drive Types

The output torque and power from a stepper motor are determined by the operating current, motor size, motor heat sinking, motor winding, and the type of the drive used. You can get much different performances from a given motor by choosing different type stepper drives.

There are some commonly-used drive types, such as unipolar constant voltage drive, unipolar L/nR constant voltage drive, unipolar timed bi-level drive, unipolar constant current drive, unipolar constant current drive and bipolar constant current microstep drive. The highest output power and motor utilization for a given motor is achieved with the bipolar constant current drive. DC-losses is kept at a minimum due to maximum utilization of the copper in the winding and no power losses from leakage inductance and snubbing circuits since every winding only consists of one part.

Bipolar constant current microstep drive is an improved version of the basic full- and half-step bipolar constant-current drive. Here, the winding currents form a sine/cosine pair. This greatly improves low frequency performances by eliminating overshoot movements, ringing, and resonances. Performances at medium and high-stepper rates are close to those of full- and half-step. Microstep can also increase resolution and step accuracy of the stepper systems.


Supply Voltage and Output Current

Although both regulated and unregulated power supplies can be used to power the drives, unregulated power supplies are preferred due to their ability to withstand current surge. The power supply voltage must be within the drive's allowable operating voltage range. Beyond that, the choice of voltage is dependent on the application and the motor used.

Higher supply voltage can increase motor torque at higher speeds, being helpful for avoiding losing steps. However, higher voltage may cause bigger motor vibration at lower speed, and may also cause over-voltage protection or even drive damage. Therefore, it is suggested to choose only a sufficiently high supply voltage for intended application, and use power supplies with theoretical output voltage of at least 10% below drive's maximum input voltage, leaving room for power fluctuation and back-EMF.

For a given motor, higher drive current will make the motor output more torque, but it also causes more heating in the motor and drive. Therefore, output current is generally set to be such that the motor will not overheat for long time operation. Phase current rating supplied by motor manufacturer is important when setting a drive's output current, however the current setting also depends on the leads and motor connections. Since parallel and series connections of motor coils will significantly change the resulting inductance and resistance, it is important to set drive output current based on motor's phase current and connection types.


Leadshine's stepper drives cover a broad operating voltage range, from 18 to 312VDC or 18 to 220VAC. And most of Leadshine's stepper drives have over-voltage and over-current protection functions. All of Leadshine's stepper drives use DIP switches to set motor's operating current, and all of them have automatic idle-current reduction function for lower heating.

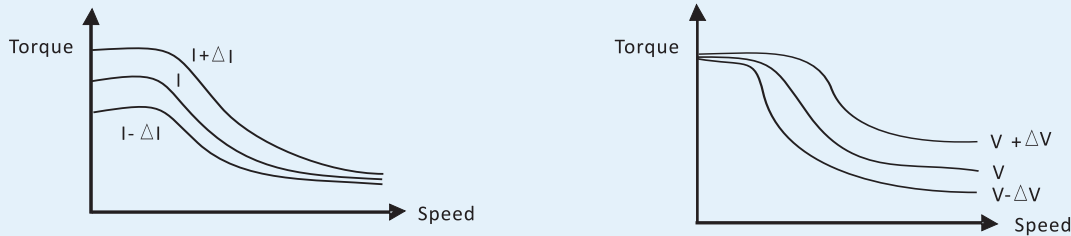


Drive Modes

The most common drive modes are full-step, half-step and microstepping.


FULL-STEP MODE: This is the basic stepper driving mode, it offers the simplest control electronics and it is recommended for high and medium frequency operation. At these frequencies, the inertia of the motor and the load smooth out the torque, resulting in less vibration and noise compared to low-speed operation.



HALF-STEP MODE: Half-step gives smoother movement at low step rates compared to full-step and can be used to lower resonances at low speeds. Half-step doubles the system resolution. Observe that for most stepper motors, the step accuracy specification only is valid for 2-phase-on positions. The accuracy is lower and the stop-position hysteresis is larger for 1-phase-on positions.



Microstepping: The smoothest movement at low frequencies can be achieved with microstepping. If resonance-free movement at low step rates is important, the microstepping drive is the best choice. Microstepping can also be used to increase stop position accuracy beyond the normal motor limits.




Leadshine's stepper drives cover all drive modes. Both our digital stepper drives and analog stepper drives can operate in full-step, half-step and microstepping modes.

Leadshine Stepper Drives

Since releasing its first stepper drive in 1997, Leadshine has been designing stepper drives to satisfy the requirements of its customers. Today, Leadshine is one of the **LARGEST** stepper drive manufacturers in the world. Every year, over **900,000** Leadshine stepper drives are implemented in thousands of applications around the world. The applications include CNC routers, laser machines, electronic equipment, medical equipment, packaging machines, textile equipment, pick-and-place devices, etc.

Currently, Leadshine offers three main series of 2-phase microstepping drives, the digital EM series, DM series and analog M series. The high performance DM drives are based on powerful 32-bit DSP control technology. Their features include extra-low stepper noise, anti-resonance, low-speed ripple smoothing, and low motor heating. The EM series drives are leadshine's highest performance discrete stepper drives. They adopt more innovative technologies than the DM series, thus have more features, such as sensorless stall detection, user password protection, etc. The low-cost M drives employ precise analog current control and are characterized by extra high-speed torque, relatively low stepper noise and motor heating. Leadshine also supplies 3-phase digital and analog stepper drives.

Part Number

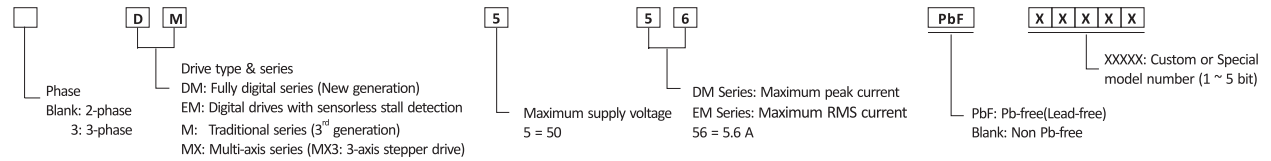

Selection Table

Phase	Series	Model	Output Current (A)	Operating Voltage (V)	Microstep Resolution	Driving Motors (NEMA Size)	Weight (kg)	Size (mm)	Control Signals	
									PUL/DIR; CW/CCW	Single-ended; Differential
2	EM	EM402	0.3 - 2.2	DC(20-40)	1-512	14, 17, 23	0.12	86*55*20	PUL/DIR;	Single-ended; Differential
		EM503	0.5 - 4.5	DC(20-50)	1-512	14, 17, 23	0.2	116*69*26.5	PUL/DIR; CW/CCW	Single-ended; Differential
		EM705	0.5 - 7.8	DC(20-75)	1-512	17, 23, 34	0.29	118*75.5*34	PUL/DIR; CW/CCW	Single-ended; Differential
		EM806	0.5 - 8.4	DC(24-80)	1-512	17, 23, 34	0.58	151*97*48	PUL/DIR;	Single-ended; Differential
	DM	DM422C	0.3 - 2.2	DC(18-40)	1-512	14, 17, 23	0.115	86*55*20	PUL/DIR; CW/CCW	Single-ended;
		DM556	0.5 - 5.6	DC(18-50)	1-512	14, 17, 23	0.28	118*75.5*34	PUL/DIR; CW/CCW	Single-ended; Differential
		DM870	0.5 - 7.0	DC(18-80)	1-512	17, 23, 34	0.28	118*75.5*34	PUL/DIR; CW/CCW	Single-ended; Differential
		DM1182	0.5-8.2	AC(80-150)	1-512	34, 42	1.3	202*167*63	PUL/DIR; CW/CCW	Single-ended; Differential
		DM2282	0.5-8.2	AC(80-220)	1-512	34, 42	1.3	202*167*63	PUL/DIR; CW/CCW	Single-ended; Differential
		DM805-AI	0.5-7.0	DC(18-80)	1-512	17, 23, 34	0.28	118*75.5*34	PUL/DIR; CW/CCW	Single-ended; Differential
		M	M542	1.0-4.2	DC(20-50)	2-128, 5-125	14, 17, 23	0.28	118*75.5*34	PUL/DIR; CW/CCW
	M550		1.2 - 5.0	DC(20-50)	2-256, 5-200	14, 17, 23	0.28	118*75.5*34	PUL/DIR; CW/CCW	Single-ended; Differential
	M760		1.45 - 6.0	DC(20-75)	2-256, 5-200	17, 23, 34	0.57	118*75.5*34	PUL/DIR; CW/CCW	Single-ended; Differential
	M860		2.4 - 7.2	DC(24-80)	2-256, 5-200	17, 23, 34	0.57	151*97*48	PUL/DIR; CW/CCW	Single-ended; Differential
	M880A		2.8 - 7.8	DC(24-80)	2-256, 5-200	17, 23, 34	0.57	151*97*48	PUL/DIR; CW/CCW	Single-ended; Differential
3	DM	3DM683	0.5 - 8.3	DC(18-60)	200-51200s/r	17, 23, 34	0.30	118*75.5*34	PUL/DIR; CW/CCW	Single-ended; Differential
		3DM2283	0.5 - 11.7	AC(150-220)	200-25600s/r	34, 42, 51	1.3	200*137*81	PUL/DIR; CW/CCW	Single-ended; Differential
2	MX (DM)	MX3660	1.4 - 6.0	DC(20-60)	2-64	17, 23, 34	0.68	168*77.5*37	PUL/DIR;	Single-ended;
		MX4650	1.0 - 5.0	DC(20-60)	2-64	17, 23, 34	TBD	220*77.5*40	PUL/DIR;	Single-ended;

Operating Environment for Leadshine's Standard Drives

Cooling	Natural cooling or forced cooling	
	Environment	Avoid dust, oil fog and corrosive gases
Operating Environment	Ambient Temperature	0 to +50 °C
	Humidity	40-90% RH
	Vibration	5.9m/s ² MAX
Storage Temperature	-20 to 125 °C	

Tips

- Operating temperature of Leadshine standard drives should below 70°C (158°F); and motor working temperature should below 80°C (176°F). Use automatic idle-current function to reduce drive and motor heating when a motor stops. Use forced cooling to cool the system if necessary.
- To improve anti-interference performance of the system, use twisted pair shielded cable for control signals and correctly ground the system. To prevent noise coupling on pulse/direction signals, pulse/direction signal wires, motor wires and power wires should not be tied up together. Separate them by at least 10 centimeters (4 inches) to avoid disturbing signals generated by a stepper motor, which can easily disturb pulse and direction signals and cause motor position error, system instability and other failures.
- Don't pull and plug motor or power wires while a stepper drive is powered ON, because there is high current flowing through motor coils (even stopped). Doing that would result in extremely high voltage surge, and could damage the drive.
- If a power supply serves multiple drives, separately connecting the drives (each in a star arrangements) is recommended instead of daisy-chain arrangement.


* UL approved products are available.

** Command sources include step/direction, analog(0-5V).



EM Series Digital Stepper Drives

Sensorless stall detection and Extra-low motor noise

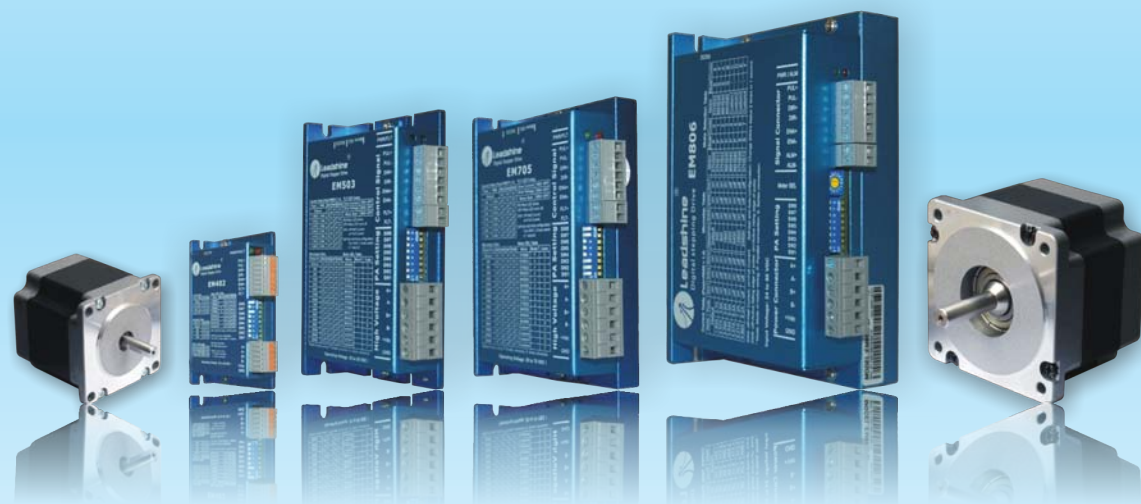

Innovative Technologies

- Sensorless Stall Detection
- Extra-low Motor Noise
- Drive Configuration Protection
- Anti-Resonance Technology
- Low-speed Ripple Smoothing
- Multi-stepping Technology
- Soft Start Technology
- Self-test and Auto-configuration

Specifications


Type	Model	Voltage	RMS Cur.	Matching Motors
DC Input	EM402	20-40 VDC	0.07-1.6A	NEMA8 to 23
	EM503	20-50 VDC	0.21-3.2A	NEMA14 to 23
	EM705	20-75 VDC	0.35-5.5A	NEMA17 to 34
	EM806	24-80 VDC	0.35-6.0A	NEMA23 to 34
AC Input	EM1206H*	80-150 VAC	0.35-6.0A	NEMA34 to 42
	EM2306H*	80-230 VAC	0.35-6.0A	NEMA34 to 51

• Over voltage, over current, short-circuit protections and fault out.
*Available time: to be determined.

Innovative Technologies


1 Sensorless Stall Detection

By detecting motor voltage, current, and back-emf signal, EM series drives can detect loss-of-synchronization of stepper motors without encoders. The sensorless stall detection eliminates cost of feedback devices and time of cable connection.

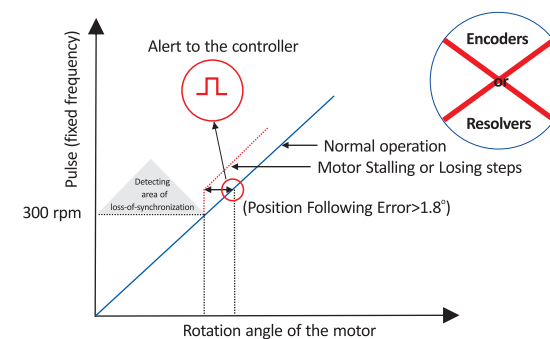


2 Extra-low Motor Noise

Precision current control technology and multi-stepping technology can reduce about 70% motor noise, making the EM series to be an ideal solution for the applications require extra-low motor noise.

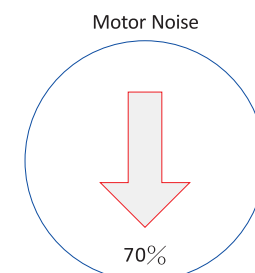


4 Anti-Resonance at Mid-range

Most stepper systems resonate at mid-range speed between 10 to 18 rps. EM stepper drives can calculate natural frequency of the stepper system and apply damping in control algorithm for anti-resonance, Providing optimizing torque and nulling mid-range instability.

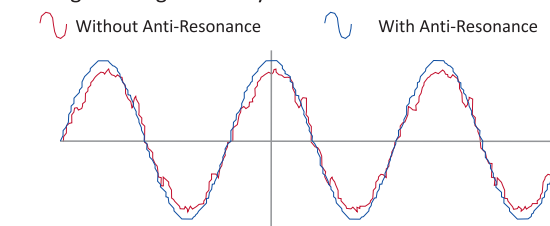


3 Low-speed Ripple Smoothing

Electronic damping for 3 major resonance frequencies for stepper motors at low speed range, eliminating undesirable motor speed oscillation and delivering unique level of smoothness.

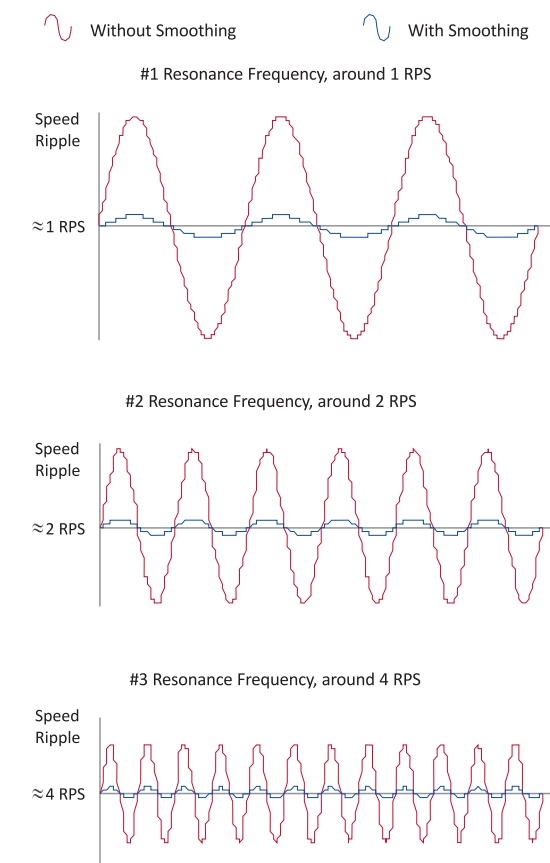

5 Multi-stepping Technology


Multi-stepping allows a low resolution input to produce a higher microstep output for smoother system performance. This function can improve smoothness of the stepper systems without upgrading your motion controllers.

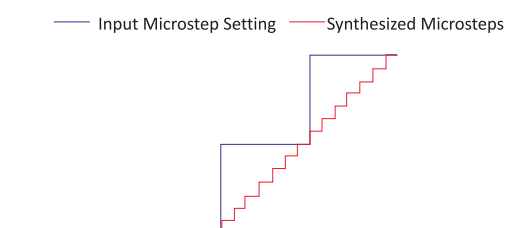

Innovative Technologies


6 Command Signal Smoothing

Command signal smoothing can soften the effect of sudden changes in velocity and direction, thus delivering smoother performance and improving system lifetime.

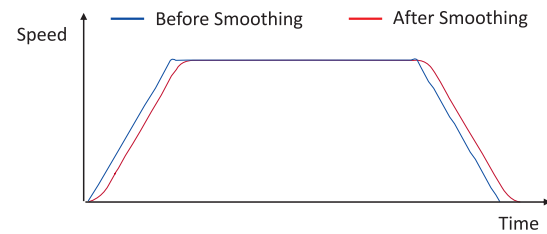


8 Lower Heating Technology

Due to DSP precision current control algorithm, motor heat is 10—20 °C lower compare to a traditional stepper drive. Longer motor lifetime can be achieved, reducing maintenance cost. Drive heat is also 20% lower, offering higher drive stability and energy efficiency.

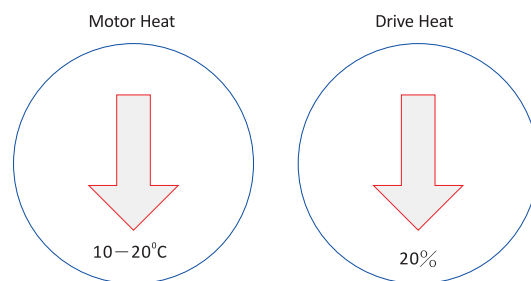

10 Self-test and Auto-configuration


Motor-self-test and parameter-auto-configuration technology offers optimum performance for different motors. It is easier for users to configure different axes or build different machines.



Turn SW4 2 times switch in 1 second .


7 Soft Start Technology

On power up of a stepper motor, soft start technology allows a stepper motor gradually applying the shaft torque to the load and avoid "starting shock" to the machine. This function is implemented through software, so no additional hardware needed.

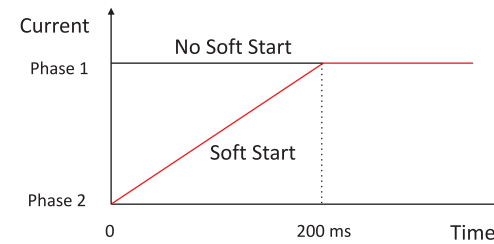

9 Torque Improvement

Torque improvement increases torque up to 30% at high speed, therefore they can drive a normal stepper motor to 3000 RPM or even higher, and significantly increase production efficiency.

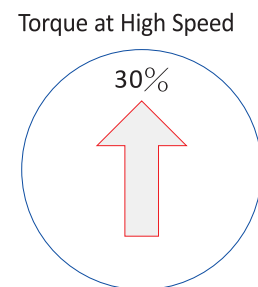

11 Drive Configuration Protection

Drive configuration protection allows you to prevent others from copying your stepper drive configuration.



Features

- **Sensorless stall detection** eliminates cost of feedback devices and time of cable connection
- **Extra-low motor noise** offers excellent quietness
- **Drive Configuration protection** prevents others from copying your drive configurations
- **Anti-Resonance** optimizes torque and nulls mid-range instability
- **Self-test and Auto-configuration** technology offers optimum performance for different motors
- **Multi-stepping** allows a low resolution input to produce a higher microstep output for smoother system performance
- Built-in controller for simple test, easier to test the drive or system
- Options to set output current and microstep resolutions via DIP switch or software
- Command input of step&direction and CW/CCW pulse*
- Over-current, over-voltage, short-circuit protections besides sensorless stall detection
- **Fault out** prevents damages to your machines or the materials

Introduction

By implementing the latest motion control technologies, Leadshine's EM series DSP-based stepper drives deliver extra high performance not available before. Unique features of sensorless stall detection, extra smoothness and excellent high speed performance make the EM stepper drives deliver servo-like performance at the cost of stepper drives. They are capable of delivering high performance with sensorless stall detection to make the system more reliable. Leadshine EM series stepper drives are able to drive 2-phase stepper motors from NEMA8 to NEMA51.

Part Number

3	—	EM	—	80	—	6	—	H
Phase		Series		Max Input		Max RMS Current		Power Input Type
Blank: 2-phase		EM: EM series		40: 40 V		2: 1.5 A		Blank: DC
3: 3-phase				80: 80 V		6: 6.0 A		H: AC and DC
					

Electrical Specifications

Parameters	Input Voltage (VDC)			RMS Current (A)					
	Min	Typical	Max	Min	Typical	Max			
Model									
EM402	+20	+24	+40	0.07	-	2.0			
EM503	+20	+24	+50	0.21	-	3.2			
EM705	+20	+48	+75	0.35	-	5.5			
EM806	+24	+68	+80	0.35	-	6.0			
EM1206H	80VAC/112VDC	120VAC/170VDC	150VAC/212VDC	0.35	-	6.0			
EM2306H	80VAC/112VDC	230VAC/325VDC	240VAC/339VDC	0.35	-	6.0			
Parameters	Pulse Input Frequency (kHz)			Logic Signal Current (mA)			Isolation Resistance (MΩ)		
Model	Min	Typical	Max	Min	Typical	Max	Min	Typical	Max
EM Series	0	-	250**	7	10	16	500	-	-

* The EM402 and E806 only support step&direction command.

** That of the EM402 is 20 kHz, and that of the other models is 250 kHz.




Applications

Leadshine EM stepper drives are suitable for driving a wide range of stepper motors, from NEMA frame size 8 to 51. Typical applications include CNC routers, laser cutters, laser markers, medical equipments, X-Y tables, measurement equipments, etc.

Pin Assignment

There are two connector types for an EM stepper drive. Connector type P1 (See figure below.) is for control signal connections, and connector type P2 is for power and motor connections. The RS232 communication port is for parameter configurations via computer. See brief descriptions for these connectors and interface below.

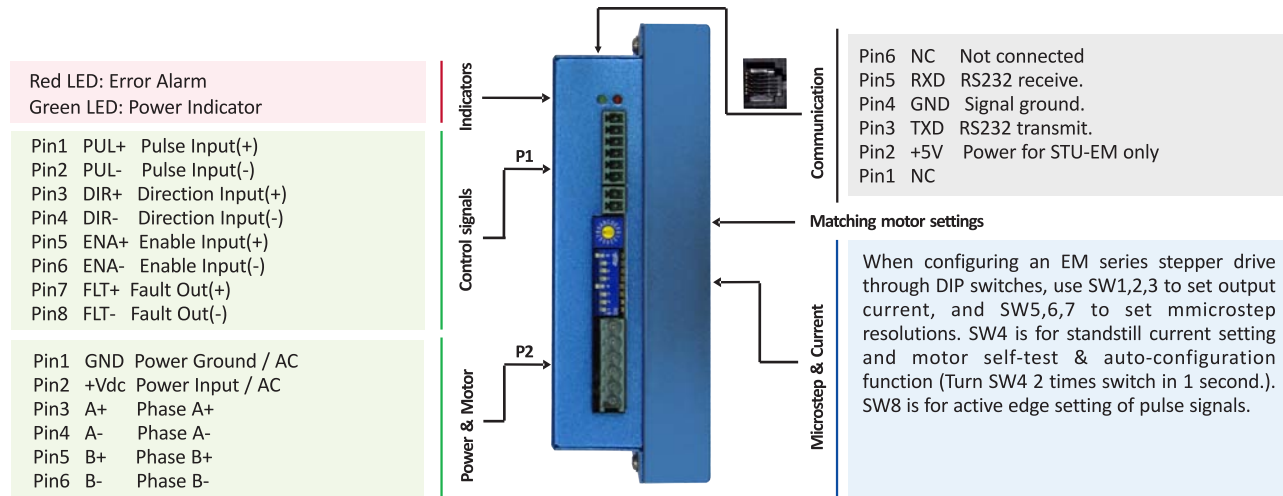


Tips:

1. Users are suggested to use motor **self-test and auto-configuration** function when powering up the system (with the motor) for the first time, or replacing a new motor.
2. To operate at current and microstep settings configured by software or STU, DIP switch must set to default mode.
3. Only software **ProTuner** can be used to configure anti-resonance parameter settings.
4. How many times the RED light blinks on in a periodic time indicates what protection has been activated. See manuals for detail.

PC Based and Handheld Configuration/Tuning Tools

For most of applications, configurations set by self-test and auto-configuration function should be good enough to meet the application requirements. However, a user can also configure the advanced features such as anti-resonance and advanced current loop tuning through software or STU-EM, a simple device specially designed for easy tuning.

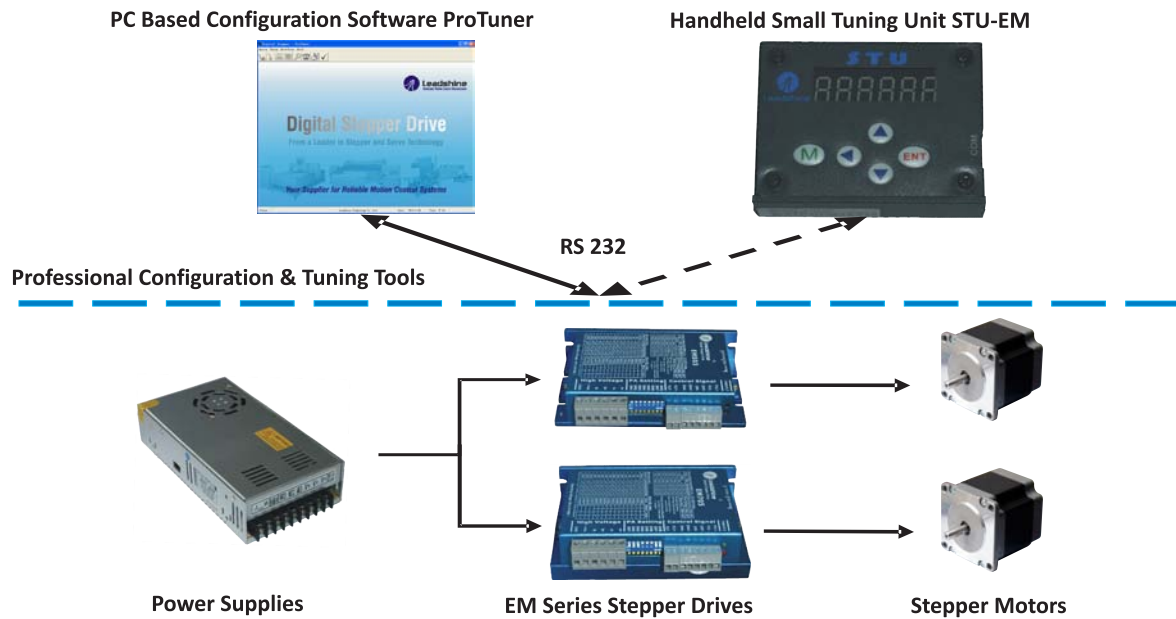


ProTuner (Windows Based Setup Software)

- User password setting
- Upload and Download parameter settings
- PI parameter settings for current loop
- Microstep resolution and output current setting
- Electronic damping coefficient setting
- Anti-resonance parameter settings for 3 resonance areas
- DIR and FLT logic level setting
- Enable and disable sensorless stall detection, ENA reset function and command signal smoothing
- Parameter settings for self motion test
- Save, open, upload and download a configuration file
- Read the latest 10 failure events and clear these events

* 1 PC RS232 interface is necessary.

** Leadshine offers special cable for communication between ProTuner and the drive.

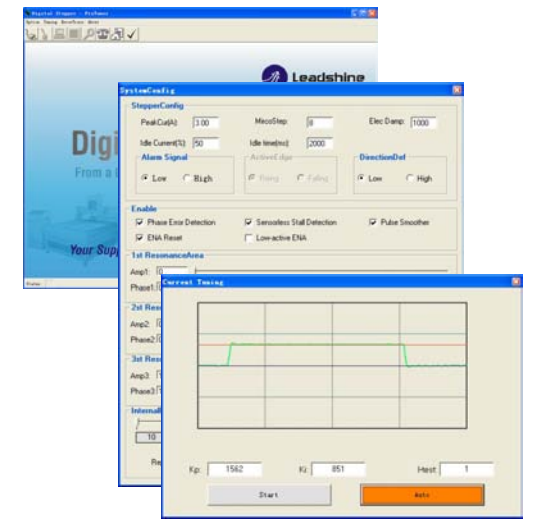


STU-EM (Handheld Configuration and Tuning Unit)

- Upload and Download parameter settings
- PI parameter settings for current loop
- Microstep resolution and output current setting
- Electronic damping coefficient setting
- DIR and FLT logic level setting
- Enable and disable sensorless stall detection, ENA reset function and command signal smoothing
- Parameter settings for self motion test
- Upload and download a configuration file

* Leadshine offers special cable for communication between the STU-EM and the drive.




Typical Connections

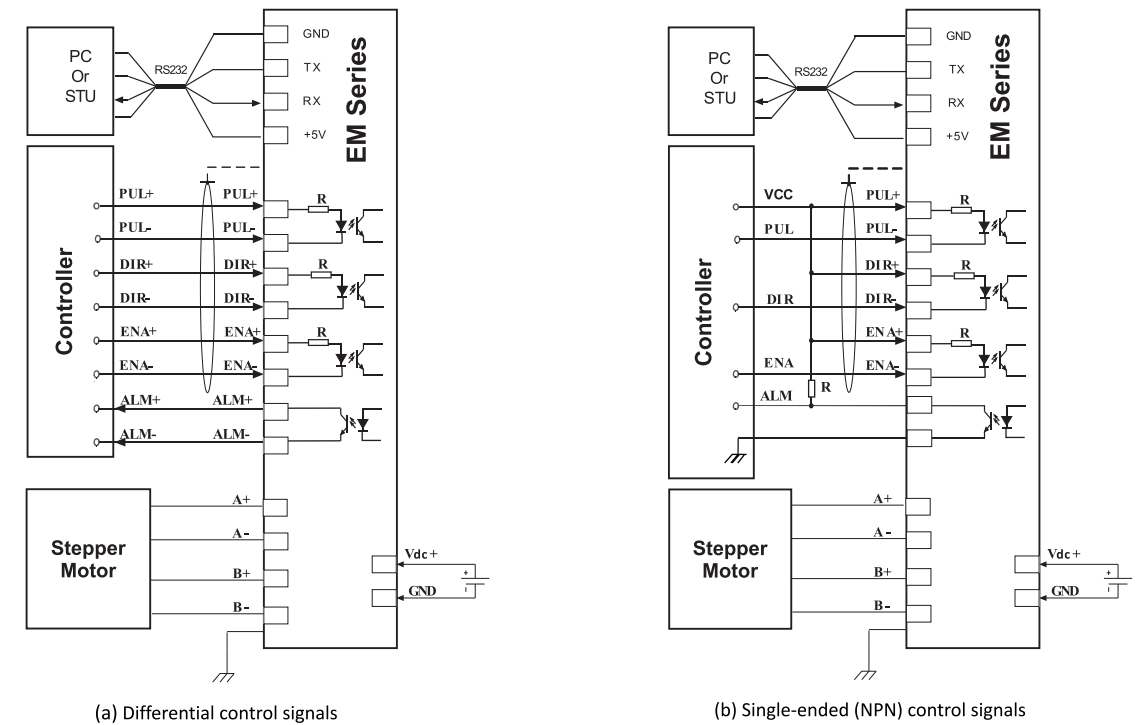




Mechanical Specifications (Unit: mm 1 inch=25.4mm)


Units: mm 1 inch=25.4mm

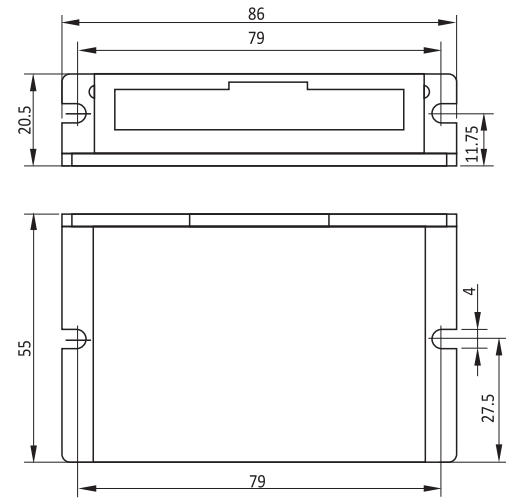


(a) Mechanical specifications of the EM402

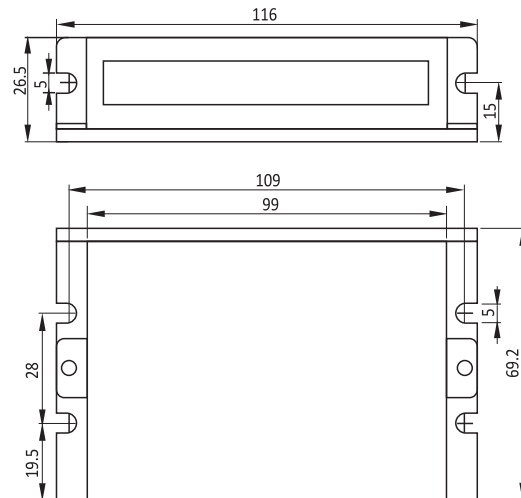


(b) Mechanical specifications of the EM503

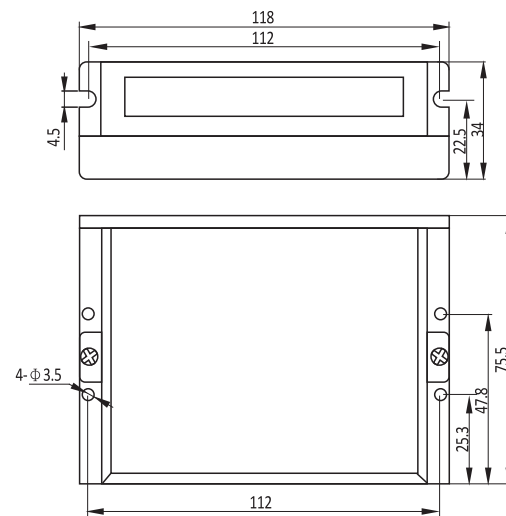

(c) Mechanical specifications of the EM705

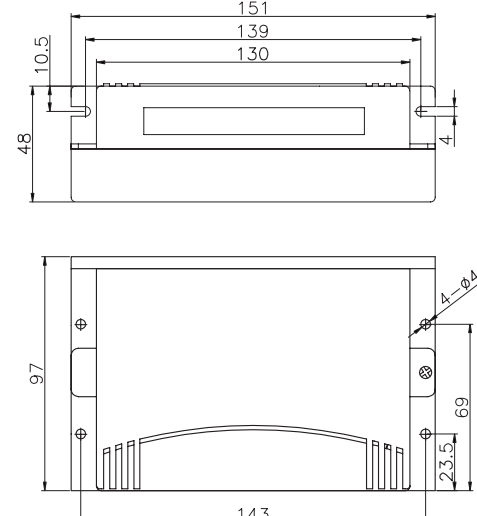


(d) Mechanical specifications of the EM806

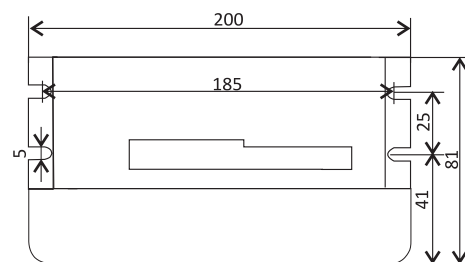


(e) Mechanical specifications of the EM1206H and EM2306H

Speed-Torque Curves of Pre-set Matching Motors*


Stepper Motor: 35HS01 (NEMA14, Holding Torque: 0.1 Nm)

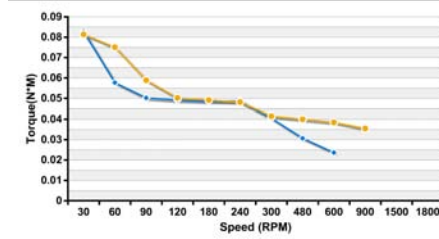


Stepper Motor: 39HS02 (NEMA16, Holding Torque: 0.2 Nm)

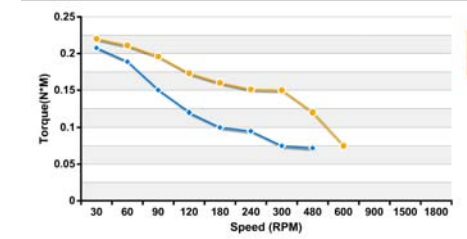


Stepper Motor: 42HS03 (NEMA17, Holding Torque: 0.3 Nm)

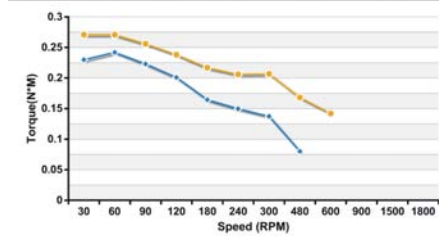


Stepper Motor: 57HS09 (NEMA23, Holding Torque: 0.9 Nm)

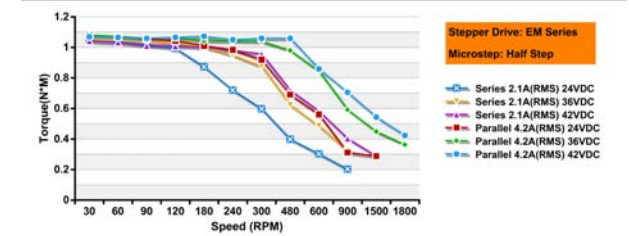


Stepper Motor: 57HS13 (NEMA23, Holding Torque: 1.3 Nm)

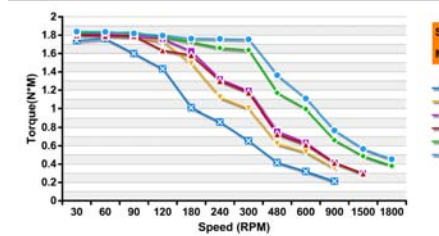


Stepper Motor: 57HS22 (NEMA23, Holding Torque: 2.0 Nm)

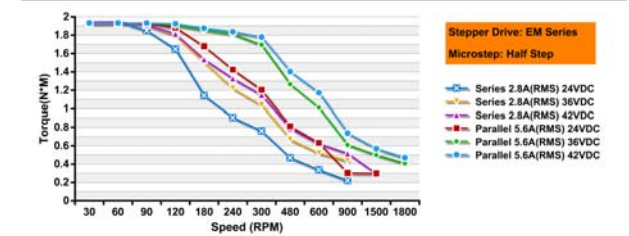


Stepper Motor: 86HS35 (NEMA34, Holding Torque: 3.5 Nm)

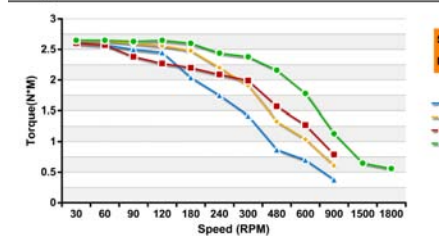

Stepper Motor: 86HS45 (NEMA34, Holding Torque: 4.5 Nm)

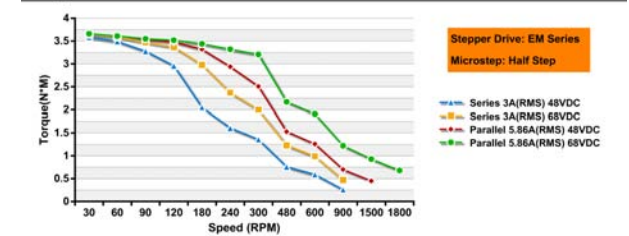

Stepper Motor: 86HS85 (NEMA34, Holding Torque: 8.5 Nm)

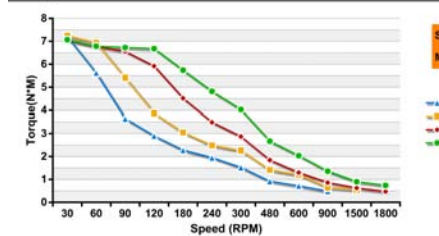


* Other curves will be released soon.

DM Series Digital Stepper Drives

Innovative Technologies


Low-speed Ripple Smoothing

Electronic damping for 3 major resonance frequencies for stepper motors at low speed range, eliminating undesirable motor speed oscillation and delivering unique level of smoothness.

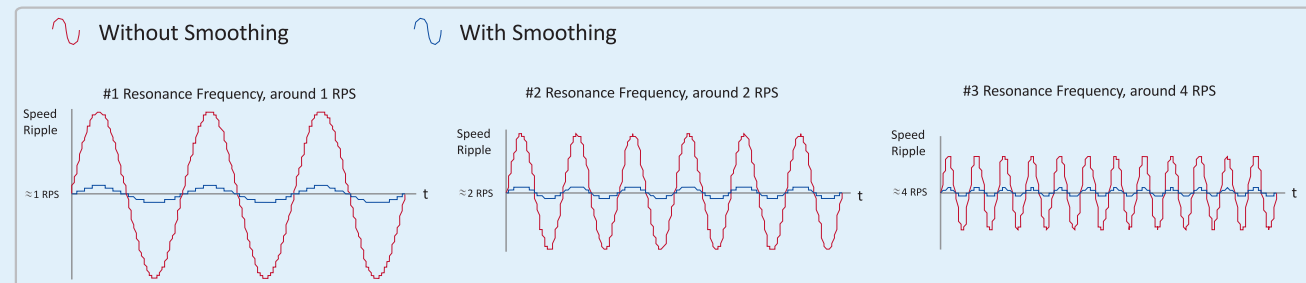


Extra-low Motor Noise

Precision current control technology and multi-stepping technology can reduce about 70% motor noise, making the DM series to be an ideal solution for the applications require extra low motor noise.

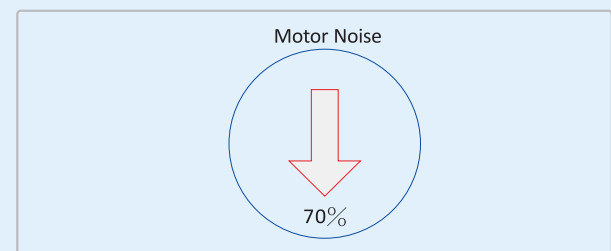


Anti-Resonance at Mid-range

Most stepper systems resonate at mid-range speed between 10 to 18 rps. The DM stepper drives can calculate natural frequency of the stepper system and apply damping in control algorithm for anti-resonance, Providing optimizing torque and nulling mid-range instability.

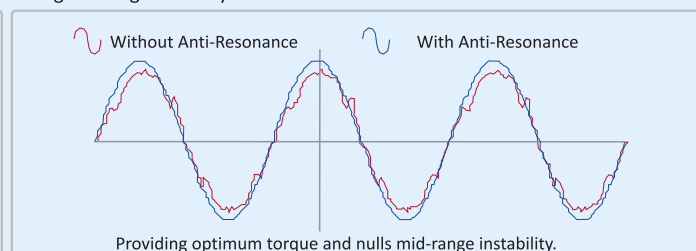


Multi-Stepping Technology

Multi-stepping allows a low resolution input to produce a higher microstep output for smoother system performance. This function can improve smoothness of the stepper systems without upgrading your motion controllers.

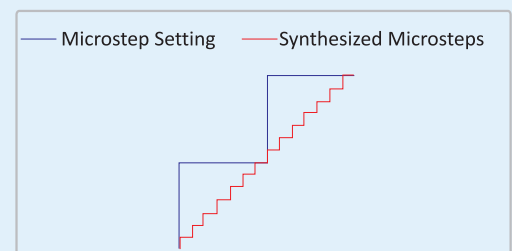


Lower Motor Heating

Due to DSP precision current control algorithm, motor heat is 10 - 20 °C lower compare to using a traditional stepper drive. Longer motor lifetime can be achieved, reducing maintenance cost.

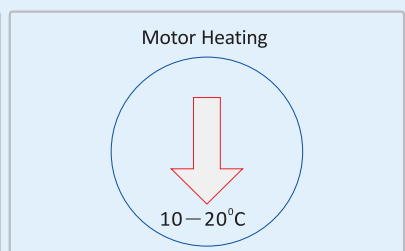


Lower Drive Heating

Drive heat is also 20% lower, offering higher drive stability and energy efficiency.

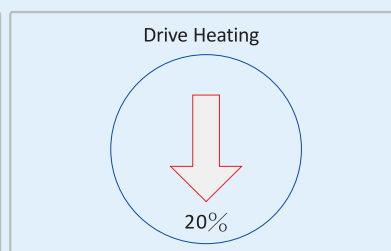


Command Signal Smoothing

Command signal smoothing can soften the effect of sudden changes in velocity and direction, thus delivering smoother performance and improving system lifetime.

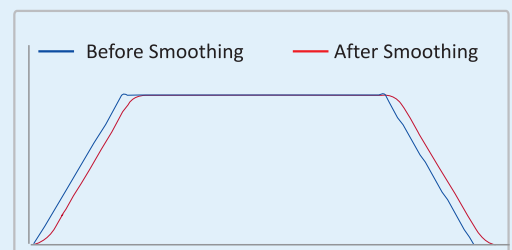


Torque Improving

Torque improvement increases torque up to 30% at high speed, therefore they can drive a normal stepper motor to 3000 RPM or even higher, and significantly increase production efficiency.

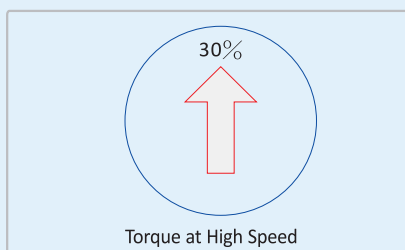

Self-test and Auto-config

Motor-self-test and parameter-auto-configuration technology offers optimum performance for different motors. It is easier for users to configure different axes or build different machines.

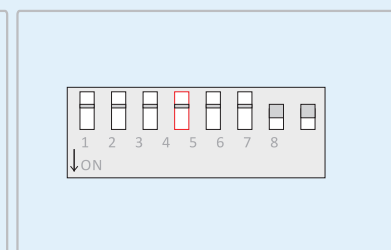

Features

- **Anti-Resonance** optimizes torque and nulls mid-range instability
- **Extra-low motor noise** offers excellent quietness
- **Self-test and Auto-configuration** technology offers optimum performance for different motors
- **Multi-stepping** allows a low resolution input to produce a higher microstep output for smoother system performance
- 2-phase and 3-phase stepper drives are available
- Options to set output current and microstep resolutions via DIP switch or software
- Command input of PUL/DIR and CW/CCW
- Over-current, over-voltage, short-circuit protections




Introduction

By implementing the latest motion control technologies, Leadshine's DM series DSP-based stepper drives deliver excellent performance not available before. Unique features of extra smoothness and excellent high speed performance make the DM stepper drives deliver servo-like performance at the cost of stepper drives. They are capable of delivering high performance without damages to your machines or the materials. Leadshine DM series stepper drives are able to drive 2-phase or 3-phase stepper motors from NEMA8 to NEMA42.

Applications

Leadshine DM stepper drives are suitable for driving a wide range of stepper motors, from NEMA frame size 8 to 42. Typical applications include CNC routers, laser cutters, laser markers, medical equipments, X-Y tables, measurement equipments, etc.

Electrical Specifications

Parameters	Input Voltage (VDC)			Output Current (A)					
Model	Min	Typical	Max	Min	Typical	Max			
DM422C 	+18	+24	+40	0.3	-	2.2			
DM556 	+18	+36	+50	0.5	-	5.6			
DM870 	+18	+60	+80	0.5	-	7.0			
DM1182	80 (VAC)	120 (VAC)	150 (VAC)	0.5	-	8.2			
DM2282	80 (VAC)	230 (VAC)	240 (VAC)	0.5	-	8.2			
3DM683	+18	+48	+60	0.5	-	8.3			
3DM2283	80 (VAC)	230 (VAC)	240 (VAC)	0.5	-	11.7			
DM805-AI	+18	+60	+80	0.5	-	7.0			
Parameters	Pulse Input Frequency (kHz)			Logic Signal Current (mA)			Isolation Resistance (MΩ)		
Model	Min	Typical	Max	Min	Typical	Max	Min	Typical	Max
DM Series	0	-	200**	7	10	16	500	-	-


* UL approved products are available.

** Maximum pulse input frequency of the DM422C is 75 kHz.



Pin Assignment and Description

There are two connector types for a DM stepper drive. Connector type P1 (See figure below.) is for control signal connections, and connector type P2 is for power and motor connections. The RS232 communication port is for parameter configurations via computer. See brief descriptions for these connectors and interface below (Not including the DM805-AI, and see related contents in page 17 for more information about the DM805-AI.).

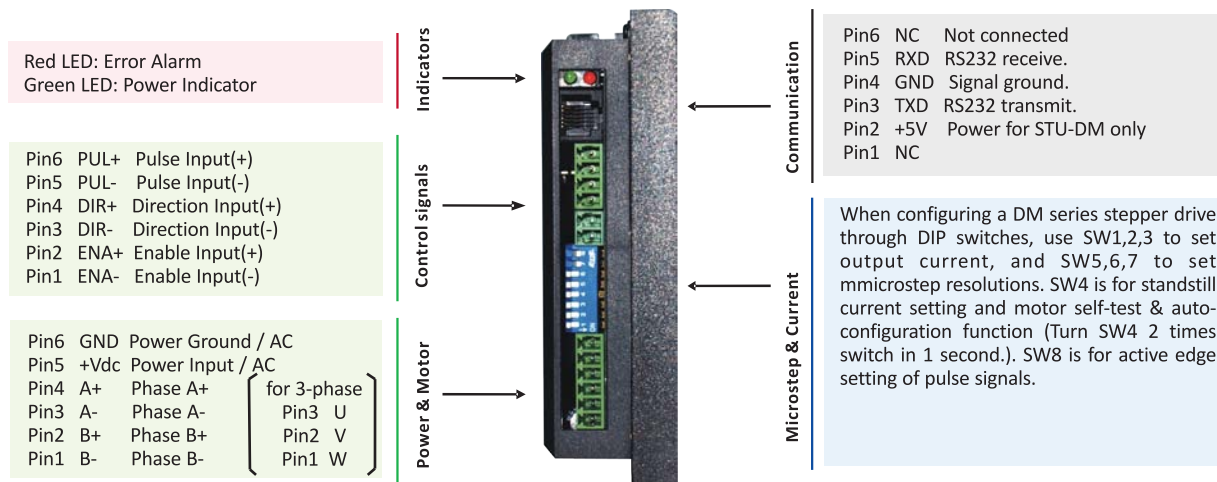

Tips:

1. Users are suggested to use motor **self-test and auto-configuration** function when powering up the system (with the motor) for the first time, or replacing a new motor.
2. To operate at current and microstep settings configured by software or STU, DIP switch must set to default mode.
3. Only software **ProTuner** can be used to configure anti-resonance parameter settings.
4. How many times the RED light blinks on in a periodic time indicates what protection has been activated. See manuals for detail.

PC Based and Handheld Configuration & Tuning Tools


For most of applications, configurations set by self-test and auto-configuration function should be good enough to meet the application requirements. However, a user can also configure the advanced features such as anti-resonance and advanced current loop tuning through software or STU-DM, a simple device specially designed for easy tuning.

ProTuner (Windows Based Setup Software)

- Upload and Download parameter settings
- PI parameter settings for current loop
- Microstep resolution and output current settings
- Operation mode configuration :PUL/DIR, CW/CCW, analog*
- DIR logic level setting
- Active edge of pulse signal setting
- Electronic damping coefficient setting
- Anti-resonance parameter settings for 3 resonance area
- Parameter settings for self motion test or a simple application
- Read the latest 10 failure events and clear these events

* 1 PC RS232 interface is necessary.

** Leadshine offers special cable for communication between ProTuner and the drive.

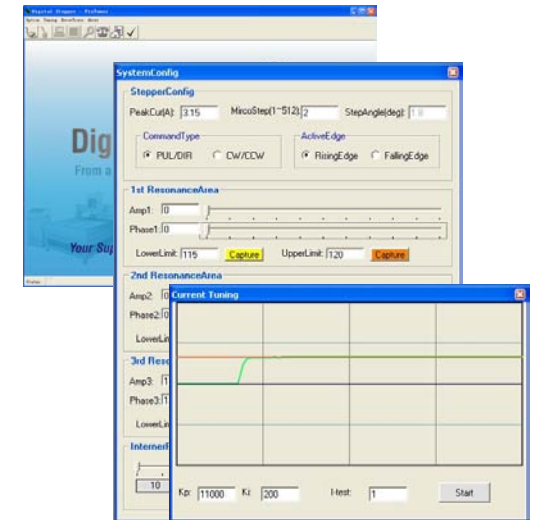


STU-DM (Handheld Configuration and Tuning Unit)

- Upload and Download parameter settings
- PI parameter settings for current loop
- Microstep resolution and output current settings
- Operation mode configuration :PUL/DIR, CW/CCW, analog*
- DIR logic level setting
- Active edge of pulse signal setting
- Parameter settings for self motion test or a simple application


* Leadshine offers special cable for communication between the STU-DM and the drive.



Typical Connections

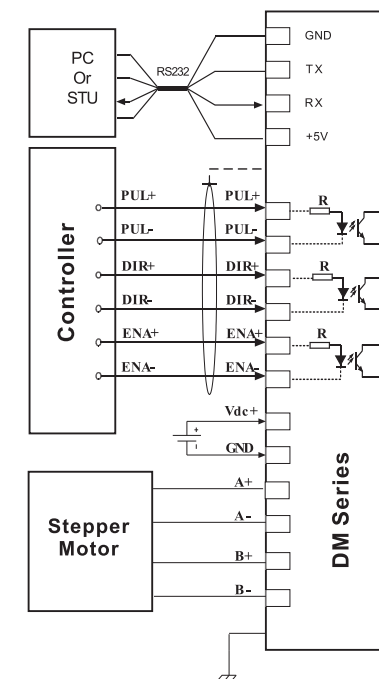


(a) Differential control signals

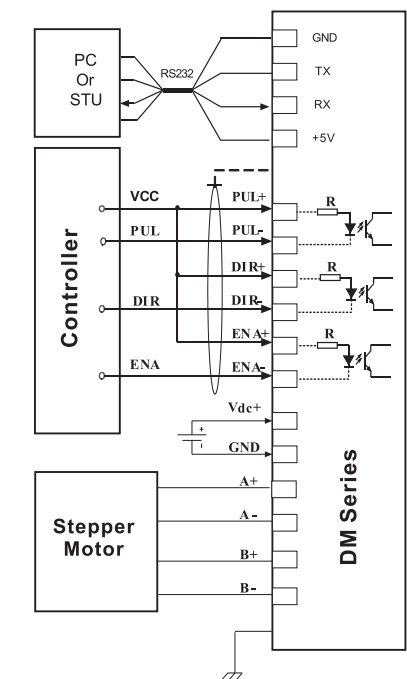

(b) Single-ended (NPN) control signals


* Only DM805-AI support analog command for the moment.

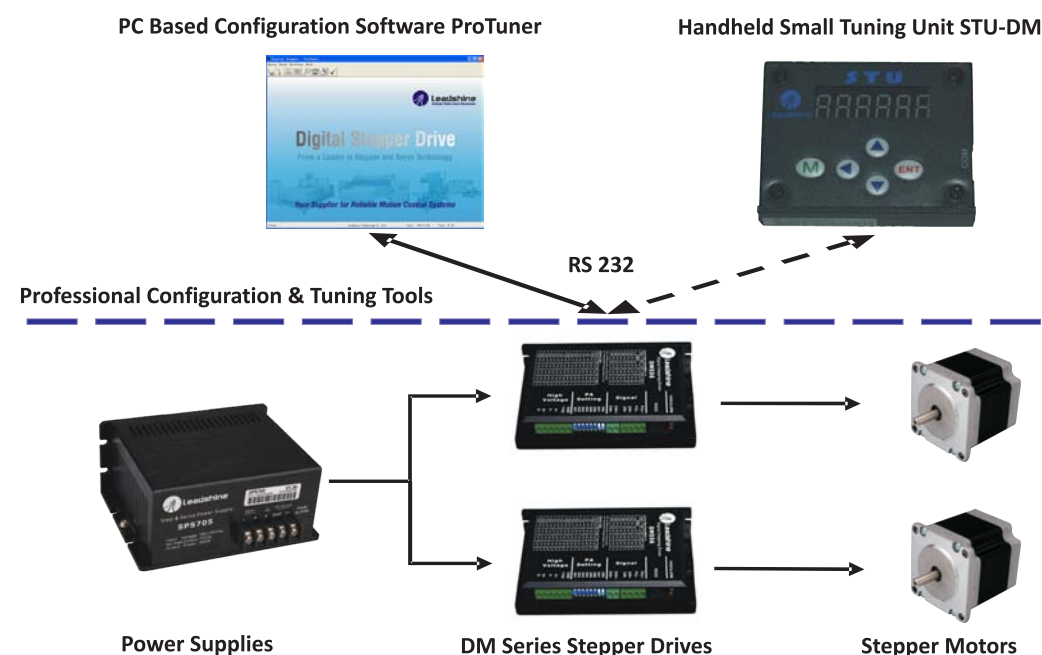




Mechanical Specifications (Unit: mm 1 inch=25.4mm)


Units: mm 1 inch=25.4mm

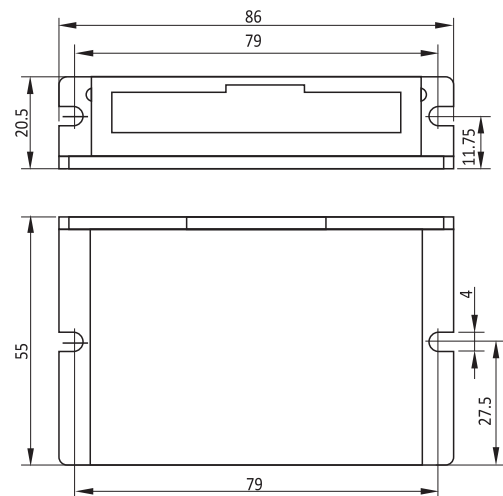


(a) Mechanical specifications of the DM422C

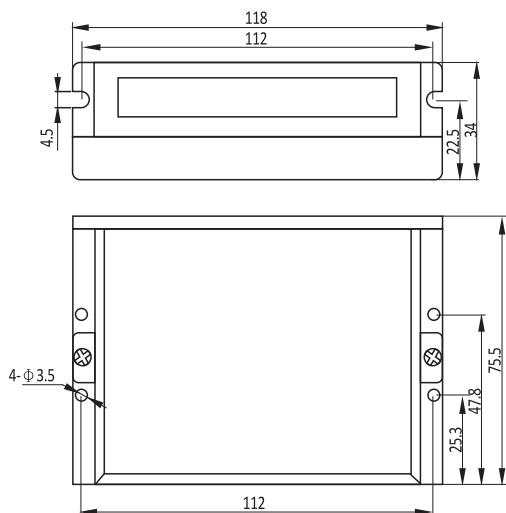

(b) Mechanical specifications of the DM556 and DM870

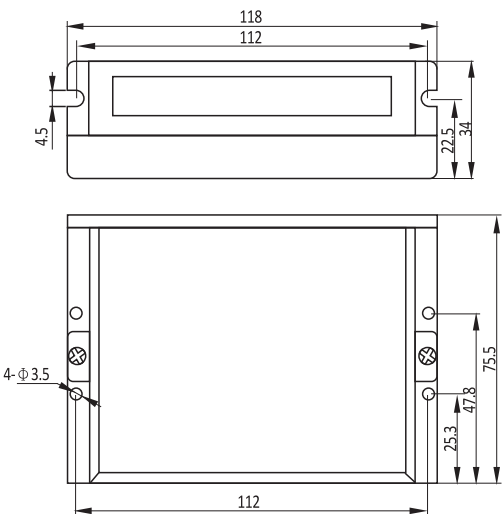

(c) Mechanical specifications of the 3DM683 and DM805-AI

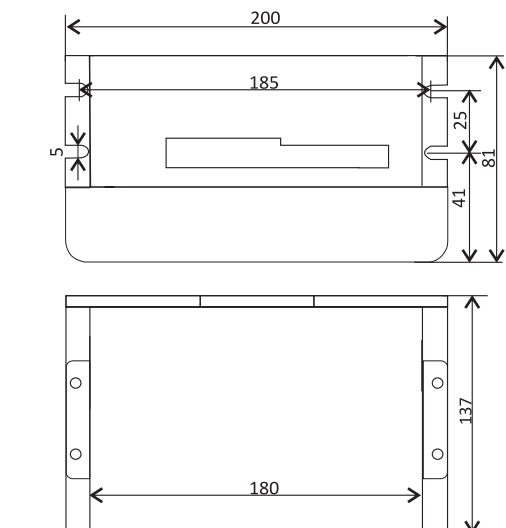

(d) Mechanical specifications of the DM1182, DM2282 and 3DM2283

DM805-AI

Introduction

The DM805-AI is a multi-function digital stepper drive and it belongs to DM series stepper drives. It has all the features that other DM drives have. The DM805-AI is distinguished from other DM series drives by it's operating modes. The DM805-AI can be operated in 4 different modes. They are 0-5V speed, low/high speed, external POT and pulse/direction modes.

Three built-in potentiometers can be used to set the velocity, acceleration and deceleration. In 0-5V speed mode, the motor speed follows the analog 0-5V input. In Low/HIGH speed mode, the motor speed is selected by the digital input and adjusted by the high/low speed potentiometers. In pulse/direction mode, the DM805-AI acts as a traditional stepper drive. There is a 5V auxiliary output for customer use. The user can run the motor with the least configuration and connection, without buying an expensive motion controller.




Function Description

Function	Description
Microstep Setting	Microstep resolution is programmable. When not in software configured mode, microstep resolution is set by SW5, 6, 7, 8 of the DIP switch. In order to avoid losing steps, do not change the microstep resolution on the fly.
Current Setting	Output current is programmable. When not in software configured mode, operating current is set by SW1,2,3 of the DIP switch. Up to 7.0 A. Select a current setting closest to your motor's required current.
Automatic standstill current reduction;	SW4 is used for the automatic standstill current reduction, self-test and auto-configuration function. When the former active, the current will automatically reduced to 60% of the selected operating current 0.4 second after the last pulse. Theoretically, this will reduce motor heating to 36% (due to $P=I^2 \cdot R$) of the original value.
Self-test and auto-configuration	If the user changes the status/position of SW4 twice in 1 second, the drive will self-test the driven motor and automatically configure control parameters, offering optimized performance with different motors.
Control Signals	The DM805-AI is a multi-function digital stepper drive. It can be operated in 0-5V speed, low/high speed, externalPOT and pulse/direction modes. There are 3 potentiometers, 4 digital inputs and 1 analog input can be configured to control the acceleration, speed, position and direction in different modes.
Motor Connector	A+, A- and B+, B- are for motor connections. Exchanging the connection of two wires for a coil to the drive will reverse default motion direction.
Power Connector	Recommended to use power supplies with output of 20 to 72 VDC, leaving room for power fluctuation and back-EMF.
Indicators	There are two LED indicators on the drive for power and alarm signals. When the Green LED is on means the drive is powered up, and when the Red LED is on means the drive is in fault status. When in fault status, the motor shaft will be free. Reset the drive by re-powering it to make it function properly after removing problem(s). See its manual for more information.

Parameter Settings

Microstep resolution, output current and operating mode are programmable. When not in software configured mode, the drive uses an 8-bit DIP switch to set microstep resolution, and motor operating current, as shown below:

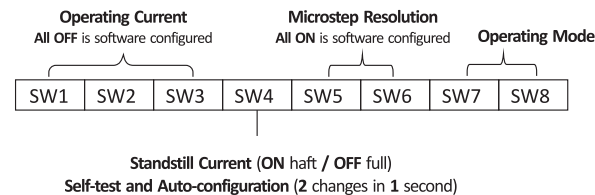

Operating Current Setting


Peak Current	RMS Current	SW1	SW2	SW3
Default (software configured, 0.5-7.0 A)		off	off	off
2.6 A	1.8 A	on	off	off
3.4 A	2.4 A	off	on	off
4.0 A	2.8 A	on	on	off
4.8 A	3.4 A	off	off	on
5.4 A	3.8 A	on	off	on
6.1 A	4.3 A	off	on	on
7.0 A	5.0 A	on	on	on

Microstep Resolution Setting

Steps/rev.	SW5	SW6
Default (software configured, 1-512)	on	on
400	off	on
1600	on	off
12800	off	off

Mechanical Specifications

Units: mm 1 inch = 25.4mm

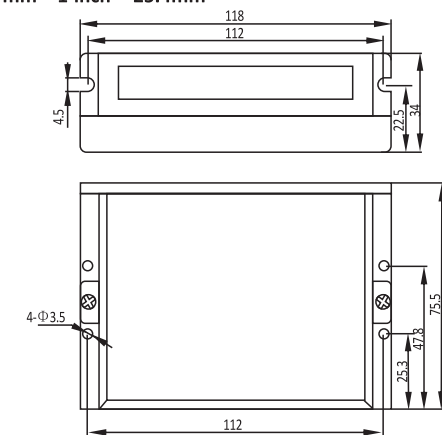




Applications

The DM805-AI is particularly suitable for the applications which need to adjust the velocity via the potentiometer or analog 0-5V command. Owing to high torque, smooth movement and extra-low motor noise at low speed, stepper solutions based on the DM805-AI can be used to replace the solutions using brushless motors and gearboxes. Such kind of motion solutions are used in various kinds of machines, such as rotary heat exchange, conveyor belts, transport vehicle, offering longer life time and lower cost than the later.

Operating Mode Setting			
Operating Modes	SW7	SW8	Descriptions
0~5 V Speed	on	on	Speed controlled by the 0~5V, and direction controlled by the direction input.
Low/High Speed	off	on	Speed controlled by the preset low speed and high speed, and direction control by the direction input.
External POT	on	off	Both speed and direction are controlled by the 0~5V. 0~2.5 V, negative direction; 2.5~5V, positive direction.
Pulse/Direction	off	off	Speed and movement distance are controlled by the pulse, and direction controlled by the direction input.

Potentiometer Function in Different Operating Modes				
Potentiometers	0~5V Speed Mode	Low/High Speed Mode	External POT Mode	Pulse/Direction Mode
Accel / Ramp	Acceleration	Ramp	Acceleration	N/A
Decel / LoSpeed	Deceleration	Low Speed	Deceleration	N/A
HiSpeed	High Speed	High Speed	High Speed	N/A

Typical Connections

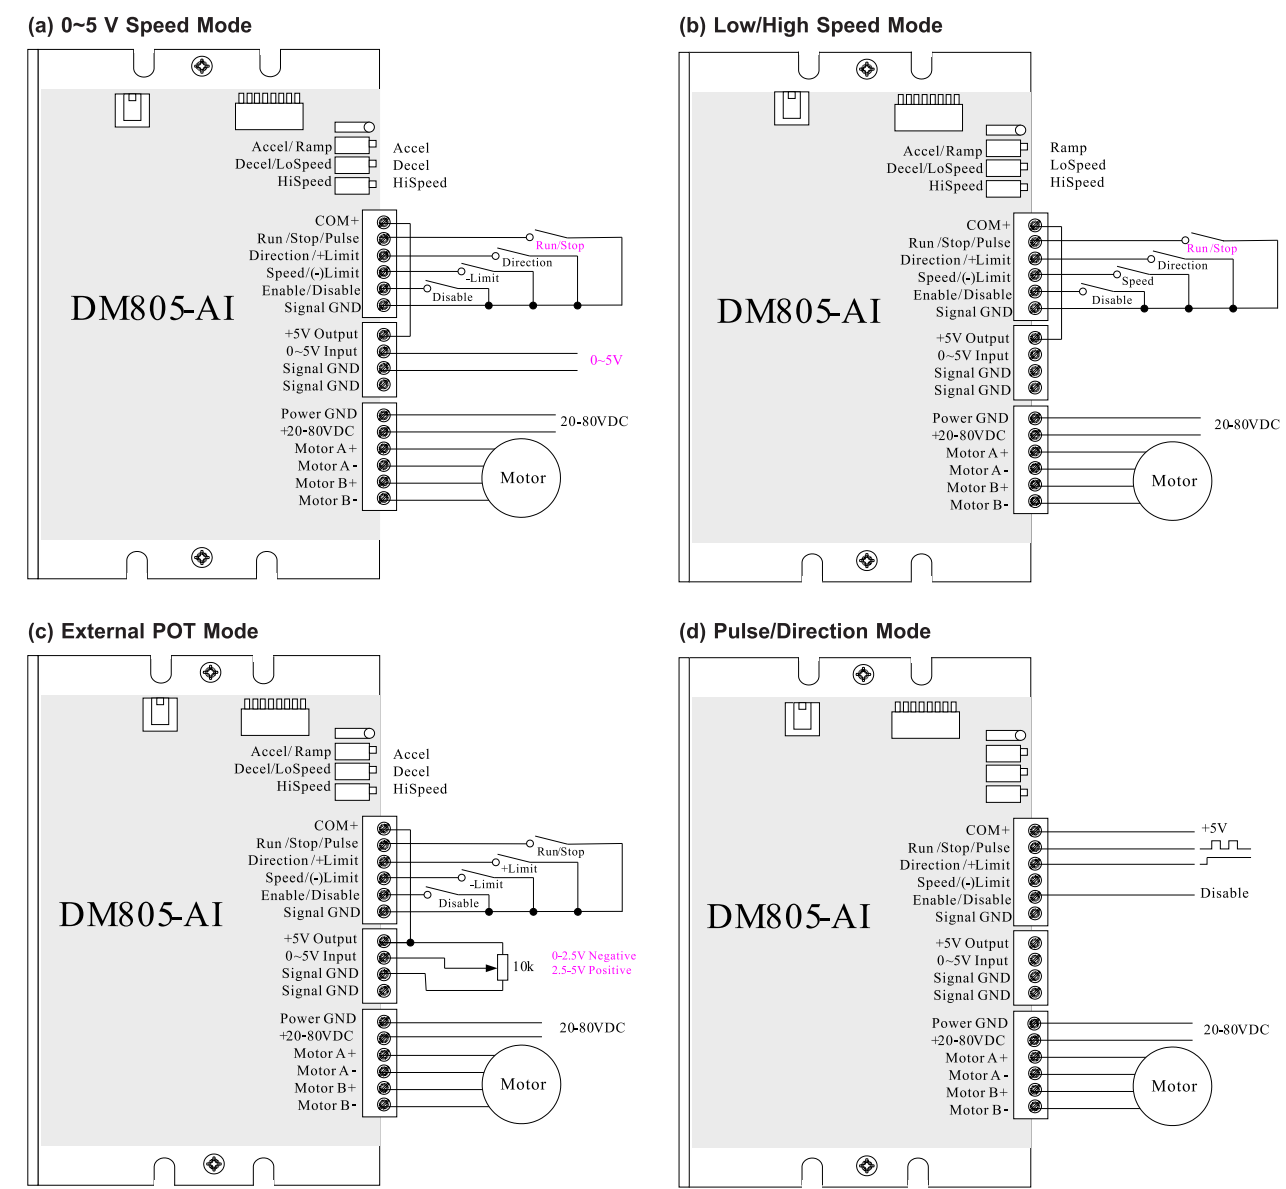

Multi-Axis Stepper Drives

Features

- Multiple-axis digital stepper drives built on latest DSP technology
- Step & direction control
- VDC working voltage up to 60 VDC
- Output current up to 6.0A
- Anti-resonance for low and middle speed
- Built-in breakout boards and IO's
- DIP switches for micro step and output current configurations
- Automatic idle current reduction to 50%
- Motor-self-test and parameter-auto-configuration
- Able to drive NEMA 17, 23, 24, and 34 stepper motors
- Direct connection to popular control systems like Mach3 and EMC



Introduction

Based on the latest DSP technology and adopting Leadshine's advanced control algorithms, Leadshine MX series was specially designed to allow easy and rapid implementation of multiple axis stepper solutions. With up to 60VDC working voltage and output current to 6.0A, Leadshine multi-axis stepper drives are capable of driving multiple 2-phase stepper motors in frame size 17, 23, 24, and 34. Leadshine multiple axis stepper drives can drive stepper systems at excellent low-to-high speed performance with high precision, extra low motor heating, smooth movement, and low motor noise. They are featured with anti-resonance, multi-stepping, digital smoothing, options of different configuration for each axis, automatic idle current reduction, and easy configurations of microstepping and output currents via DIP switches. Their integrated breakout board and built-in IO's offer easy implementation for many applications at very effect costs. The MX3660 is a 3-axis stepper drive with 4DI&4DO, and the MX4650 is a 4-axis stepper drive with 8DI&6DO.

Applications

With integrated breakout boards and built-in IO's, Leadshine MX series stepper drives can be easily implemented as general purpose stepper drives to power 3/4 two-phase stepper motors in frame size 17, 23, 24, and 34. They are ideal solutions to many applications with 3-4 axis stepper systems such as CNC machinery, electronics, semiconductors, medical, packaging, lab automation, etc. They can be easily adopted in stepper control systems for machines like CNC routers/engravers, light-duty CNC mills, CNC lathes/cutters, laser cutters/markers/engravers, CNC welders, waterjet cutters, X-Y tables, CNC dispensing machines, medical equipments, etc.

The unique design of MX series drives with integrated breakout boards and built-in IO's makes them fit seamlessly with many popular CNC control systems like Mach3, EMC, etc.

Specification Summary		
Model	MX3660	MX4660
Axis No.	3	4
Phase	2	2
Control Type	Step & Direction	Step & Direction
Operating Voltage	20 - 60 VDC	20 - 60 VDC
Suggested Power Input	24 - 54 VDC	24 - 54 VDC
Output Current (Per Axis)	1.41 - 6.0 A	1.41 - 6.0 A
Max Input Frequency	200 KHz	200 KHz
Microstep Settings	Full, Half, 1/4, 1/8, 1/10, 1/16, 1/32, 1/64	Full, Half, 1/4, 1/8, 1/10, 1/16, 1/32, 1/64
Output Current Settings (Peak)	1.41A, 2.12A, 2.83A, 3.54A, 3.96A, 4.24A, 4.95A, 6.0A	1.41A, 2.12A, 2.83A, 3.54A, 3.96A, 4.24A, 4.95A, 6.0A
Output Current Settings (RMS)	1.0A, 1.5A, 2.0A, 2.5A, 2.8A, 3.0A, 3.5A, 4.25A	1.0A, 1.5A, 2.0A, 2.5A, 2.8A, 3.0A, 3.5A, 4.25A
# of Digital Inputs	4	8
# of Digital Outputs	4	6
# of Analog Inputs	1	1
Digital Input Voltage	0 - 12 VDC	0 - 12 VDC or optional
Digital Output Voltage	0 - 24 VDC or optional	0 - 24 VDC or optional
Analog Output Signal Voltage	0 - 8.9 VDC (at 10VDC supplied voltage)	0 - 8.9 VDC (at 10VDC supplied voltage)
Minimum Step Width	2.5 μ s	2.5 μ s
Minimum Direction Setup Time	5 μ s	5 μ s
Idle Current Percentage	50%	50%
Protection Functions	Over current, over-voltage, emergency	Over current, over-voltage, emergency
Dimension	169 X 77.5 X 37 mm	220 X 77.5 X 40 mm



MX3660

Parameter Settings


Via DIP switches of a MX3660, a user can easily set stepper motor current and resolution configurations. Each individual axis can be set with different configurations. For example, you can configure axis 1 with 1/16 micro step & 6.0A to drive a large NEMA 34 stepper motor, axis 2 with 1/10 micro step & 2.83A to drive a NEMA 23 stepper motor, and axis 3 with 1/8 micro step & 1.41A current to drive a NEMA 17 stepper motor.

Operating Current

SW1 SW2 SW3


Microstep Resolution

SW4 SW5 SW6



Operating Current Setting					Microstep Resolution Setting					
Peak Current	RMS Current	SW1	SW2	SW3	Steps / rev.	SW4	SW5	SW6		
1.41 A	1.0 A	on	on	on	200	on	on	on		
2.12 A	1.5 A	off	on	on	400	off	on	on		
2.83 A	2.0 A	on	off	on	800	on	off	on		
3.54 A	2.5 A	off	off	on	1600	off	off	on		
3.96 A	2.8 A	on	on	off	2000	on	on	off		
4.24 A	3.0 A	off	on	off	3200	off	on	off		
4.95 A	3.5 A	on	off	off	6400	on	off	off		
6.0 A	4.25 A	off	off	off	12800	off	off	off		

Typical Connections

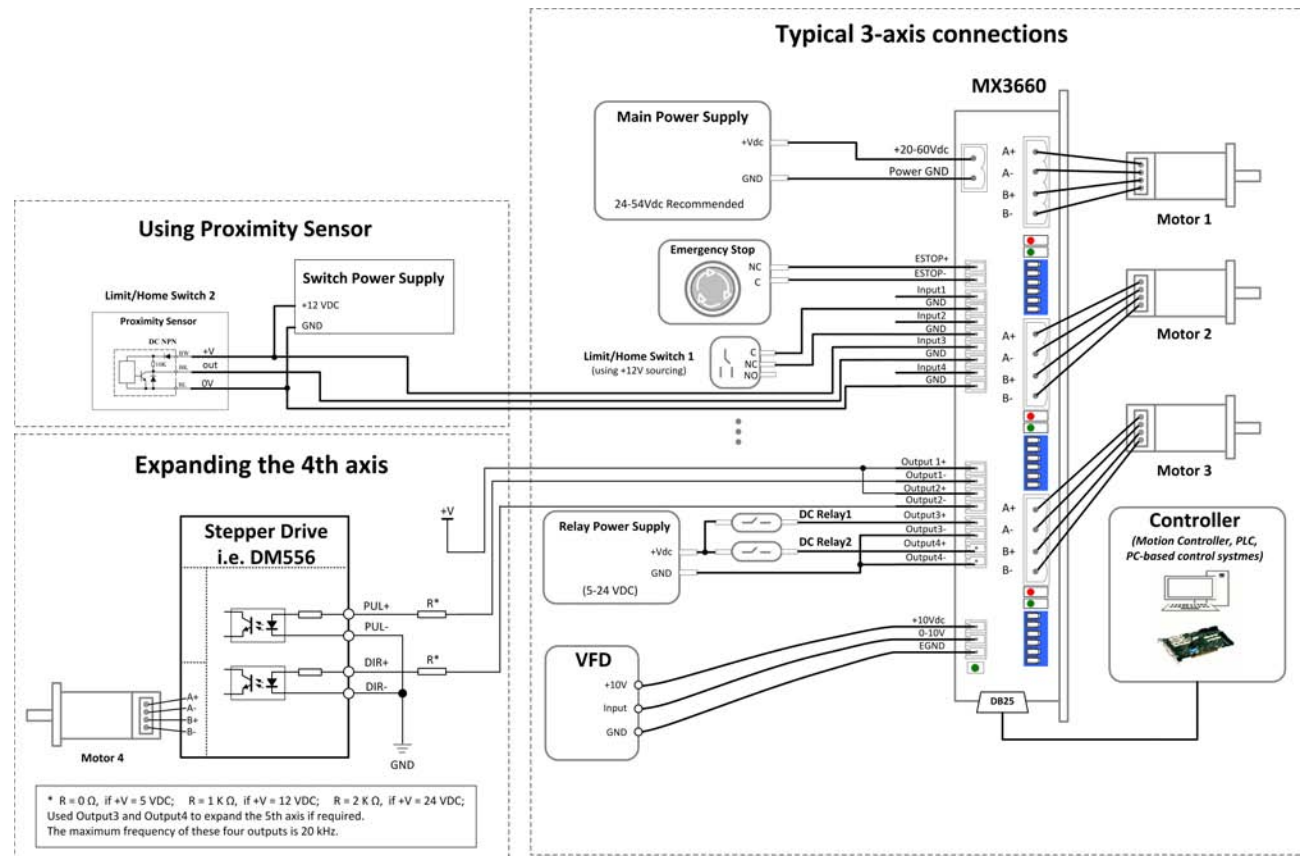

MX4660

Parameter Settings


Via DIP switches of a MX4650, a user can easily set stepper motor current and resolution configurations. Each individual axis can be set with different configurations. For example, you can configure axis 1 with 1/16 micro step & 6.0A to drive a large NEMA 34 stepper motor, axis 2 and axis 3 with 1/10 micro step & 2.83A to drive two NEMA 23 stepper motors, and axis 4 with 1/8 micro step & 1.41A current to drive a NEMA 17 stepper motor.

Operating Current

SW1 SW2 SW3


Microstep Resolution

SW4 SW5 SW6



Operating Current Setting					Microstep Resolution Setting					
Peak Current	RMS Current	SW1	SW2	SW3	Steps / rev.	SW4	SW5	SW6		
1.41 A	1.0 A	on	on	on	200	on	on	on		
2.12 A	1.5 A	off	on	on	400	off	on	on		
2.83 A	2.0 A	on	off	on	800	on	off	on		
3.54 A	2.5 A	off	off	on	1600	off	off	on		
3.96 A	2.8 A	on	on	off	2000	on	on	off		
4.24 A	3.0 A	off	on	off	3200	off	on	off		
4.95 A	3.5 A	on	off	off	6400	on	off	off		
6.0 A	4.25 A	off	off	off	12800	off	off	off		


Typical Connections

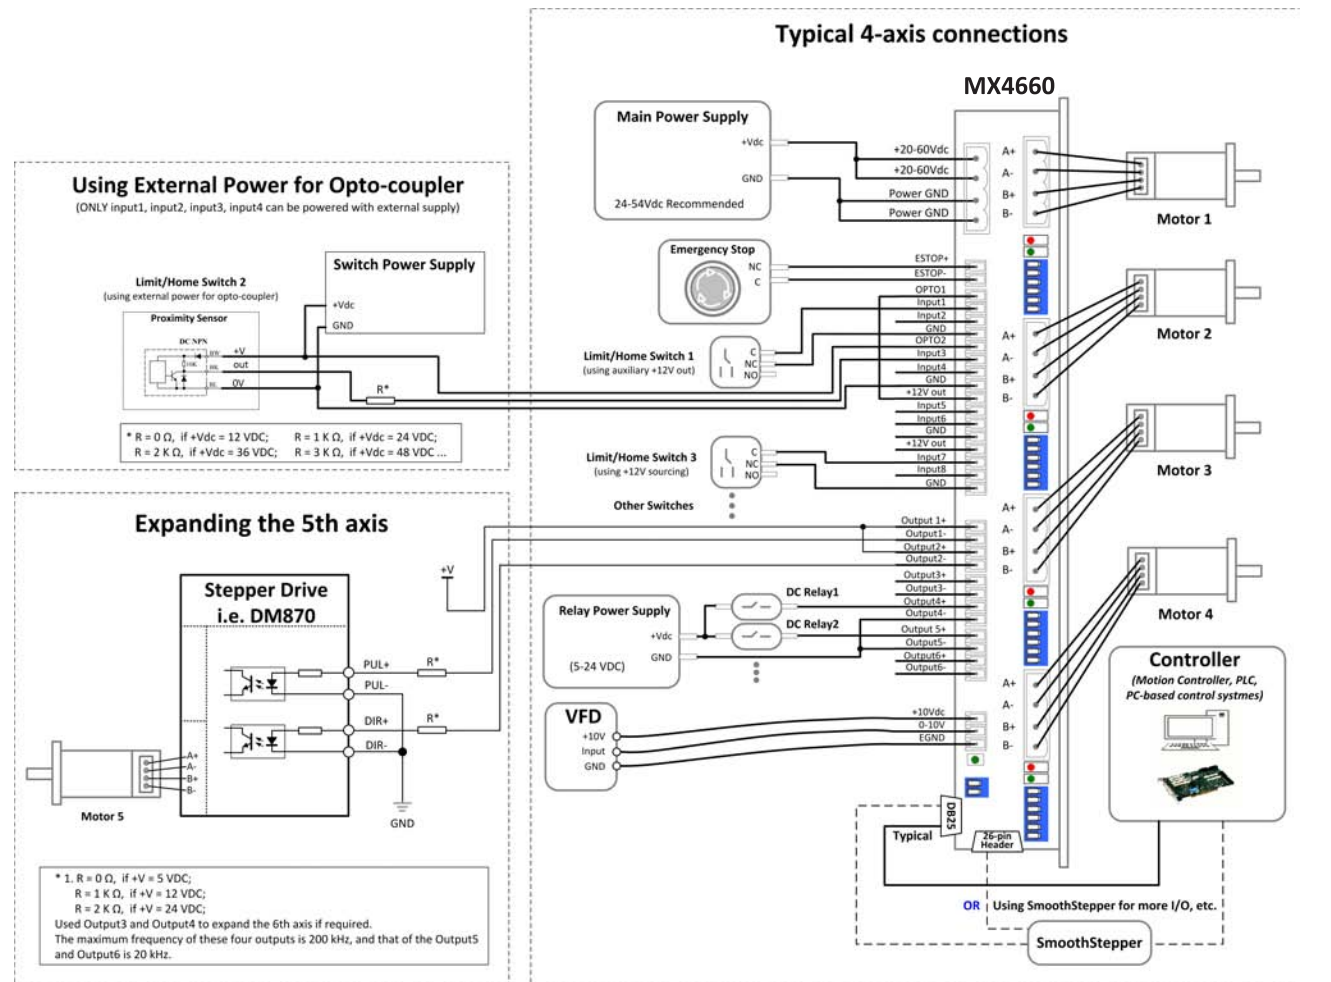




Mechanical Specifications

Units: mm 1 inch = 25.4mm

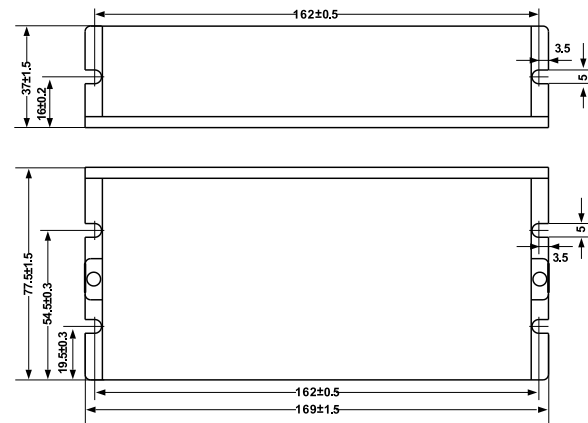

(a) Mechanical specifications of the MX3660

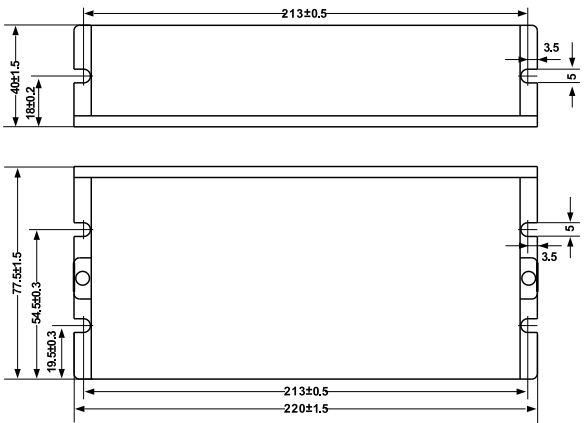

(b) Mechanical specifications of the MX4660

Selection Guide	24
2-phase Stepper Motors	
35HSxx	26
39HSxx	26
42HSxx	27
57HSxx	28
86HSxx	29
110HSxx	30
130HSxx	31
3-phase Stepper Motors	
573Sxx	32
863Sxx	33
Speed-Torque Curves of 2-phase Motors	34
Speed-Torque Curves of 3-phase Motors	35


Stepper Motors



Stepper Motor Basic

A stepper motor is an electromechanical device which converts electrical pulses into discrete mechanical movements. The shaft of a stepper motor rotates in discrete step increments when electrical command pulses are applied to it in a proper sequence. The motor rotation has several direct relationships to these applied input pulses. The sequence of the applied pulses is directly related to the direction of motor shafts rotation. The speed of the motor shafts rotation is directly related to the frequency of the input pulses and the length of rotation is directly related to the number of input pulses applied.

A stepper motor can be a good choice whenever controlled movement is required. They can be used in applications where you need to control rotation angle, speed, position and synchronism. Because of the inherent advantages, stepper motors have found their places in many different applications, such as CNC routers, laser machines, and so on.

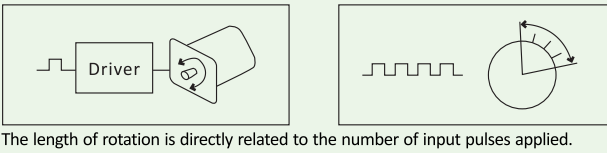

Stepper Motor Types

There are three basic stepper motor types. They are variable-reluctance, permanent-magnet and hybrid.

Variable-reluctance (VR)

This type of motor consists of a soft iron multi-toothed rotor and a wound stator. When the stator windings are energized with DC current the poles become magnetized. Rotation occurs when the rotor teeth are attracted to the energized stator poles.

Permanent Magnet (PM)

Often referred to as a "tin can" or "canstock" motor, the permanent magnet step motor is a low cost and low resolution type motor. PM motors as the name implies have permanent magnets added to the motor structure. The magnetized rotor poles provide an increased magnetic flux intensity and because of this the PM motor exhibits improved torque characteristics when compared with the VR type.

Hybrid (HB)

The hybrid stepper motor provides better performance with respect to step resolution, torque and speed. The hybrid stepper motor combines the best features of both the PM and VR type stepper motors. The rotor is multi-toothed like the VR motor and contains an axially magnetized concentric magnet around its shaft. This further increases the detent, holding and dynamic torque characteristics of the motor when compared with both the VR and PM types. Generally speaking, the hybrid motor may be the better choice along with reducing cost, for it offers better performance with respect to step resolution, torque and speed.

Normal Selection Steps

You can follow the following steps to choose a stepper motor.

1. Determining the Drive Mechanism Component

Determine the mechanism and required specifications. First, determine certain features of the design, such as mechanism, rough dimensions, distances moved, and positioning period.

2. Calculate the Required Resolution

Find the resolution the motor requires. From the required resolution, determine whether a motor only or a geared motor is to be used. The resolution and positioning accuracy of a stepper motor system is affected by several factors—the stepper angle, the selected drive mode (full-step, half-step or microstepper), and the gear rate.

3. Determine the Operating Pattern

Determine the operating pattern that fulfills the required specifications. Find the acceleration (deceleration) period and operating pulse speed in order to calculate the acceleration torque.

4. Calculate the Required Torque

Calculate the load torque and acceleration torque and find the required torque demanded by the motor.

5. Select the Motor


Make a provisional selection of a motor based on required torque. Determine the motor to be used from the speed-torque characteristics.

6. Check the Selected Motor

Confirm the acceleration/deceleration rate and inertia ratio.

Motor Connections

The M series drives can drive any 2-phase, 4-phase hybrid stepper motors, including 4-lead, 6-lead and 8-lead motors. Step angle of the motors can be 1.8 or 0.9 degree. For 6-lead and 8-lead stepper motors, different connections have different performance shown in the following figures.

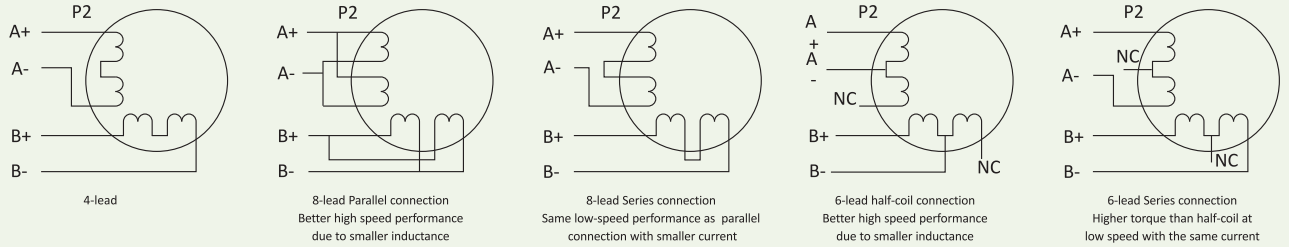


Leadshine's Stepper Motors

Leadshine offers 2-phase and 3-phase stepper motors from NEMA14 to NEMA51. Made of high quality cold roll sheet copper and anti-high temperature permanent magnet, these stepper motors are highly reliable and generate low motor heating. Because of their nice internal damping characteristics, those stepper motors can run very smoothly and have no obvious resonance area within the whole speed ranges.

Selection Table

Phase	NEMA Size	Model	Step Angle (°)	# of Leads	Connection	Current/Phase (A)	Holding Torque (Nm)	Length L (mm)	Weight (kg)	Match Drives
2	14	35HS01	1.8	4	-	0.4	0.07	26	0.15	EM402 / DM422C
	16	39HS02	1.8	4	-	0.6	0.22	34	0.2	EM402 / DM422C
	17	42HS02	1.8	4	-	0.4	0.22	40	0.24	EM402 / DM422C
		42HS03	1.8	8	Parallel	1.4	0.47	48	0.34	EM402 / DM422C
					Series	0.7	0.47			
	23	57HS04	1.8	6	Unipolar	1.0	0.34	41	0.45	EM503 / DM556
					Series	2.0	0.4			
					Unipolar	2.8	0.28			
		57HS09	1.8	8	Parallel	4.2	1.3	54	0.6	EM503 / DM556
					Series	2.1	1.3			
					Unipolar	2.8	0.9			
		57HS13	1.8	8	Parallel	4.0	1.8	76	1.0	EM503 / EM705 / DM556 / DM870
					Series	2.0	1.8			
					Unipolar	2.8	1.3			
		57HS22	1.8	8	Parallel	5.6	2.2	81	1.15	EM503 / EM705 / DM556 / DM870
					Series	2.8	2.2			
					Unipolar	4.0	1.5			
	34	86HS35	1.8	8	Parallel	4.0	3.5	65	1.7	EM705 / EM806 / DM870
					Series	2.0	3.5			
					Unipolar	2.8	2.5			
		86HS45	1.8	8	Parallel	6.0	4.5	80	2.3	EM806 / DM870 / DM1182
					Series	3.0	4.5			
					Unipolar	4.2	3.2			
	42	86HS85	1.8	8	Parallel	6.8	8.5	118	3.8	EM806 / DM870 / DM1182 / DM2282
					Series	3.4	8.5			
					Unipolar	4.9	6.0			
3	23	110HS12	1.8	4	-	5.0	12	99	5.0	DM1182 / DM2282
		110HS20	1.8	4	-	6.5	20	150	8.4	DM1182 / DM2282
		130HS27	1.8	4	-	6.0	27	227	13	DM1182 / DM2282
		130HS45	1.8	4	-	7.0	45	283	19	DM1182 / DM2282
		573S05	1.2	6	Delta	5.2	0.45	42	0.45	3DM683 / 3DM883
		573S09	1.2	6	Delta	3.5	0.9	50	0.75	3DM683 / 3DM883
	34	573S15	1.2	6	Delta	5.8	1.3	76	1.1	3DM683 / 3DM883
		863S22	1.2	6	Delta	5.0	2.3	71	1.7	3DM683 / 3DM883
		863S42	1.2	6	Delta	5.0	4.3	103	2.9	3DM683 / 3DM883
		863S68H	1.2	6	Delta	2.3	6.8	135	4.0	3DM683 / 3DM883

Part Number

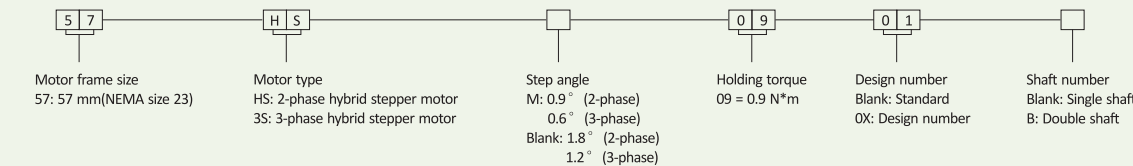

35HSxx/39HSxx Series

General Specifications	
Angle Accuracy	±5%(full step, no load)
Temperature Rise	80 °C Max
Ambient Temperature	-10 °C — +50 °C
Insulation Resistance	100M Ω min. 500VDC
Dielectric Strength	500VAC for one minute
Shaft Radial Play	0.06 Max. (450g-load)
Shaft Axial Play	0.08 Max. (450g-load)



Selection Table										
Phase	NEMA Size	Model	Step Angle (°)	# of Leads	Connection	Current/Phase (A)	Holding Torque (Nm)	Length L (mm)	Weight (kg)	Match Drives
2	14	35HS01	1.8	4	-	0.4	0.07	26	0.15	EM402 / DM422C
	16	39HS02	1.8	4	-	0.6	0.22	34	0.20	EM402 / DM422C

Mechanical Specifications

Unit: mm 1inch=25.4mm

Wiring Diagram

Mechanical Specifications


Unit: mm 1inch=25.4mm

Wiring Diagram

Match Drives	
Model	Match Drives
35HSxx / 39HSxx	EM402 / DM422C

42HSxx Series

General Specifications	
Angle Accuracy	±5%(full step, no load)
Temperature Rise	80 °C Max
Ambient Temperature	-10 °C — +50 °C
Insulation Resistance	100M Ω min. 500VDC
Dielectric Strength	500VAC for one minute
Shaft Radial Play	0.06 Max. (450g-load)
Shaft Axial Play	0.08 Max. (450g-load)

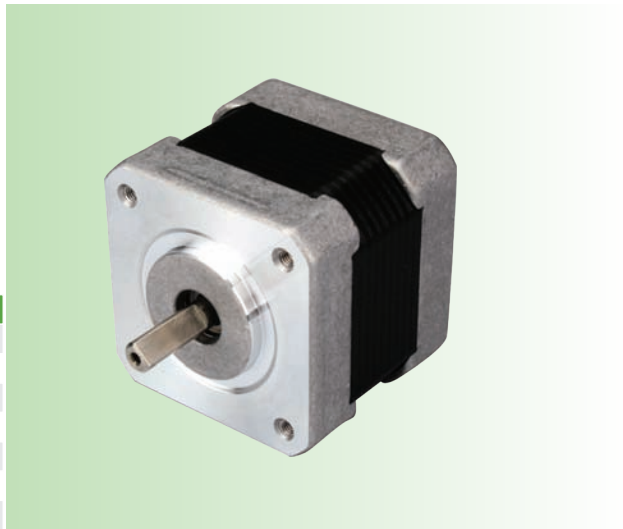

Selection Table										
Phase	NEMA Size	Model	Step Angle (°)	# of Leads	Connection	Current/Phase (A)	Holding Torque (Nm)	Length L (mm)	Weight (kg)	Match Drives
2	17	42HS02	1.8	4	-	0.4	0.22	40	0.24	EM402 / DM422C
					Parallel	1.4	0.47	48	0.34	EM402 / DM422C
		42HS03	1.8	8	Series	0.7	0.47			
					Unipolar	1.0	0.34			

Mechanical Specifications

Unit: mm 1inch=25.4mm

Wiring Diagram

Mechanical Specifications


Unit: mm 1inch=25.4mm

Wiring Diagram

Match Drives	
Model	Match Drives
42HSxx	EM402 / DM422C



57HSxx Series

General Specifications		
Angle Accuracy	± 5%(full step, no load)	
Temperature Rise	80 °C Max	
Ambient Temperature	-10 °C — +50 °C	
Insulation Resistance	100M Ω min. 500VDC	
Dielectric Strength	500VAC for one minute	
Shaft Radial Play	0.06 Max. (450g-load)	
Shaft Axial Play	0.08 Max. (450g-load)	

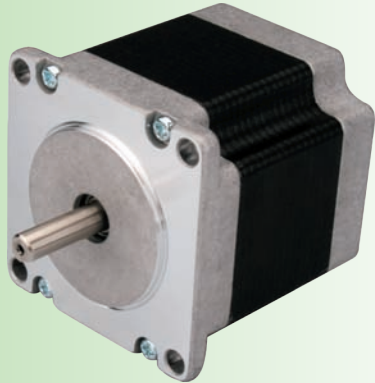

Selection Table										
Phase	NEMA Size	Model	Step Angle (°)	# of Leads	Connection	Current/Phase (A)	Holding Torque (Nm)	Length L (mm)	Weight (kg)	Match Drives
2	23	57HS04	1.8	6	Series	2.0	0.4	41	0.45	EM503 / DM556
					Unipolar	2.8	0.28			
		57HS09	1.8	8	Parallel	4.2	1.3	54	0.6	EM503 / EM705 / DM556
					Series	2.1	1.3			
		57HS13	1.8	8	Unipolar	2.8	0.9	76	1.0	EM503 / EM705 / DM556
					Parallel	4.0	1.8			
		57HS22*	1.8	8	Series	2.0	1.8	81	1.15	EM503 / EM705 / DM556
					Unipolar	2.8	1.3			
		57HS22*	1.8	8	Parallel	5.6	2.2	81	1.15	EM503 / EM705 / DM556
					Series	2.8	2.2			
					Unipolar	4.0	1.5			

* The diameter of the shaft of the 57HS22 is 8 mm, and those of the others are 6.35 mm.

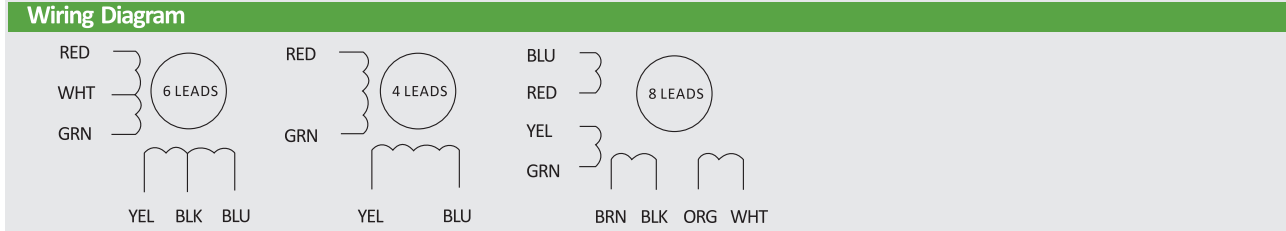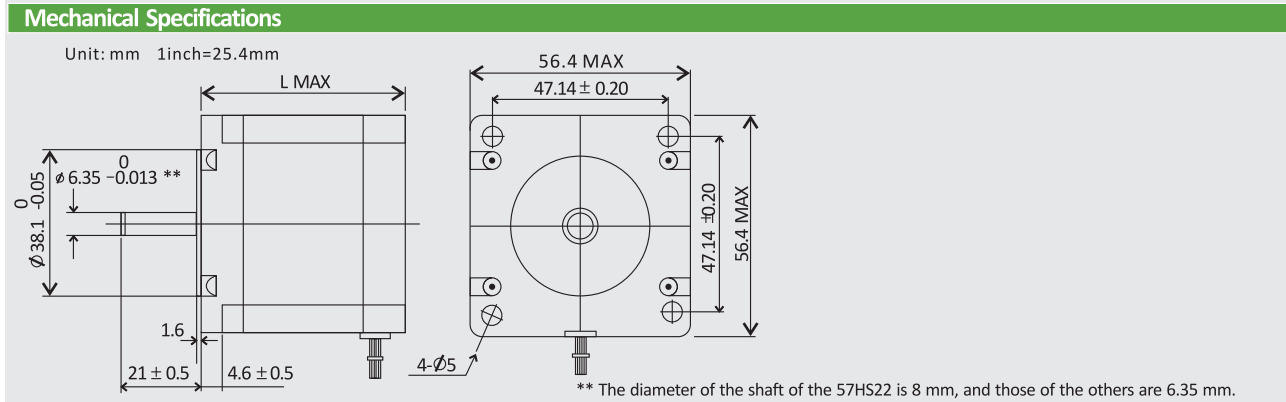


Match Drives			
Model	Match Drives	Model	Match Drives
57HS04	EM503 / EM705 / DM556	57HS13	EM503 / EM705 / DM556
57HS09		57HS22	

86HSxx Series

General Specifications		
Angle Accuracy	± 5%(full step, no load)	
Temperature Rise	80 °C Max	
Ambient Temperature	-10 °C — +50 °C	
Insulation Resistance	100M Ω min. 500VDC	
Dielectric Strength	500VAC for one minute	
Shaft Radial Play	0.06 Max. (450g-load)	
Shaft Axial Play	0.08 Max. (450g-load)	



Selection Table										
Phase	NEMA Size	Model	Step Angle (°)	# of Leads	Connection	Current/Phase (A)	Holding Torque (Nm)	Length L (mm)	Weight (kg)	Match Drives
2	34	86HS35	1.8	8	Parallel	4.0	3.5	65	1.7	EM705 / EM806 / DM870
					Series	2.0	3.5			
					Unipolar	2.8	2.5			
		86HS45	1.8	8	Parallel	6.0	4.5	80	2.3	EM705 / EM806 / DM870 / DM1182
					Series	3.0	4.5			
					Unipolar	4.2	3.2			
		86HS65	1.8	8	Parallel	6.1	6.5	96	2.3	EM806 / DM870 / DM1182 / DM2282
					Series	3.05	6.5			
					Unipolar	4.3	4.6			
		86HS85	1.8	8	Parallel	6.8	8.5	118	3.8	EM806 / DM870 / DM1182 / DM2282
					Series	3.4	8.5			
					Unipolar	4.9	6.0			
		86HS120	1.8	8	Parallel	6.0	12	156	5.3	EM806 / DM870 / DM1182 / DM2282
					Series	3.0	12			
		86HS120	1.8	8	Unipolar	4.2	8.4			

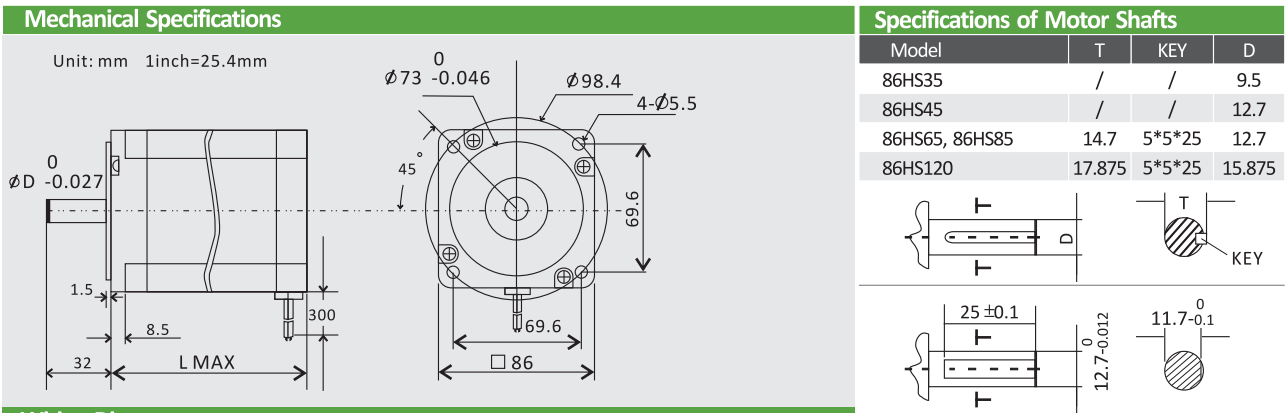

Specifications of Motor Shafts			
Model	T	KEY	D
86HS35	/	/	9.5
86HS45	/	/	12.7
86HS65, 86HS85	14.7	5*5*25	12.7
86HS120	17.875	5*5*25	15.875


The Shaft of the 86HS45

* The shaft of the 86HS35 is round, no flat.


Match Drives	
Model	Match Drives
86HS35	EM705 / EM806 / DM1182
86HS45 / 86HS65	
86HS85 / 86HS120	EM705 / EM806 / DM1182

110HSxx Series


General Specifications	
Angle Accuracy	± 5%(full step, no load)
Temperature Rise	80 °C Max
Ambient Temperature	-10 °C — +50 °C
Insulation Resistance	100M Ω min. 500VDC
Dielectric Strength	500VAC for one minute
Shaft Radial Play	0.06 Max. (450g-load)
Shaft Axial Play	0.08 Max. (450g-load)

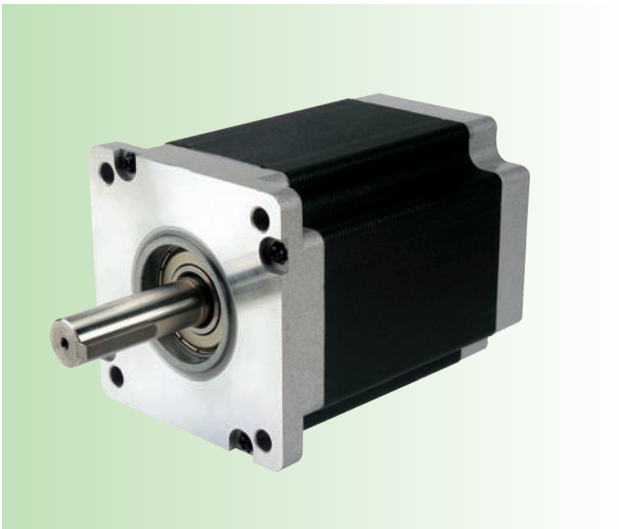

Selection Table										
Phase	NEMA Size	Model	Step Angle (°)	# of Leads	Connection	Current/Phase (A)	Holding Torque (Nm)	Length L (mm)	Weight (kg)	Match Drives
2	42	110HS12	1.8	4	-	6.0	12	115	6.0	DM2282 / DM1182
		110HS20	1.8	4	-	6.0	20	150	8.4	DM2282 / DM1182
		110HS28	1.8	4	-	6.5	28	201	11.7	DM2282 / DM1182

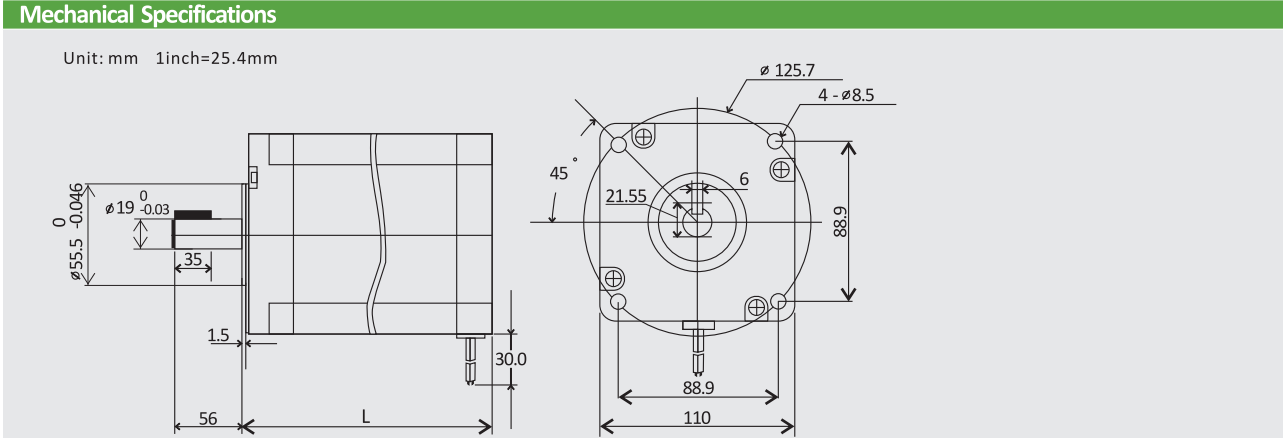

Wiring Diagram

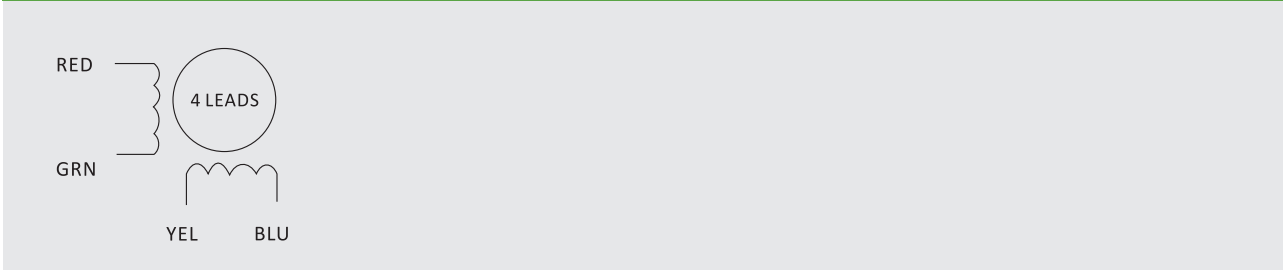


Match Drives	
Model	Match Drives
110HS12	DM2282 / DM1182
110HS20	
110HS28	

130HSxx Series


General Specifications	
Angle Accuracy	± 5%(full step, no load)
Temperature Rise	80 °C Max
Ambient Temperature	-10 °C — +50 °C
Insulation Resistance	100M Ω min. 500VDC
Dielectric Strength	500VAC for one minute
Shaft Radial Play	0.06 Max. (450g-load)
Shaft Axial Play	0.08 Max. (450g-load)




Selection Table										
Phase	NEMA Size	Model	Step Angle (°)	# of Leads	Connection	Current/Phase (A)	Holding Torque (Nm)	Length L (mm)	Weight (kg)	Match Drives
2	51	130HS27	1.8	4	-	6.0	27	227	13	DM2282 / DM1182
		130HS33	1.8	4	-	6.0	33	227	13	DM2282 / DM1182
		130HS40	1.8	4	-	7.0	40	283	16	DM2282 / DM1182
		130HS45	1.8	4	-	7.0	45	283	19	DM2282 / DM1182

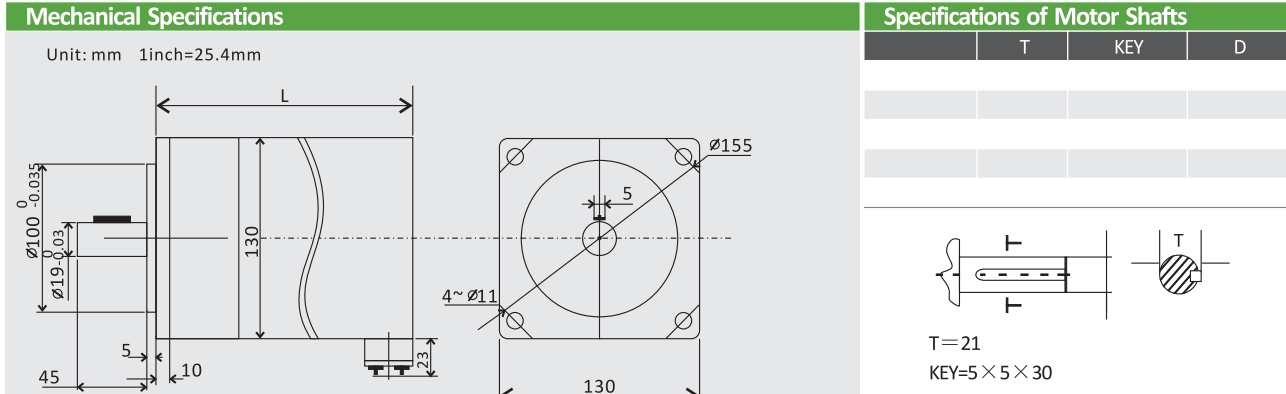

Wiring Diagram

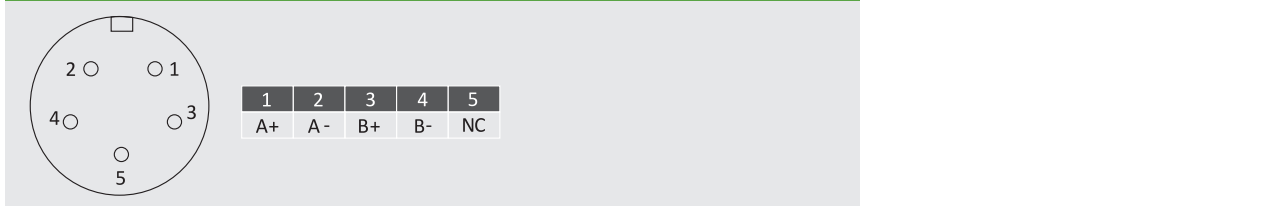


Match Drives	
Model	Match Drives
130HSxx	DM2282 / DM1182

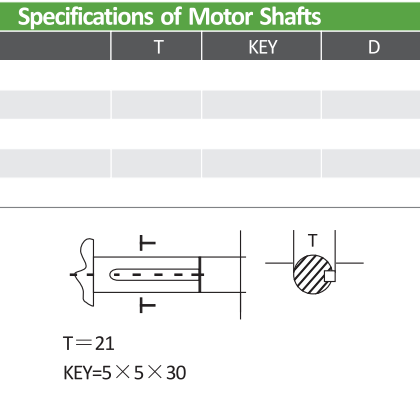

Speed-Torque Curves of 2-phase Stepper Motors


57HS09

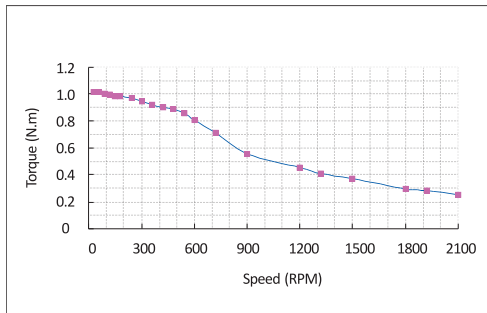

Stepper Motor: 57HS09
Stepper Drive: MD556
Input Voltage: 36 VDC

Output Current: 3.8 A(Peak)
Microstep: 1600 steps/rev.
Connection: Parallel


57HS13

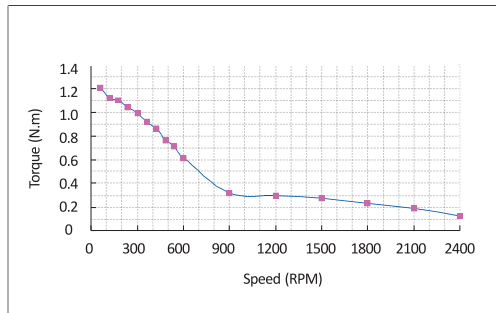

Stepper Motor: 57HS13
Stepper Drive: MD556
Input Voltage: 36 VDC

Output Current: 3.8 A(Peak)
Microstep: 2000 steps/rev.
Connection: Parallel


57HS22

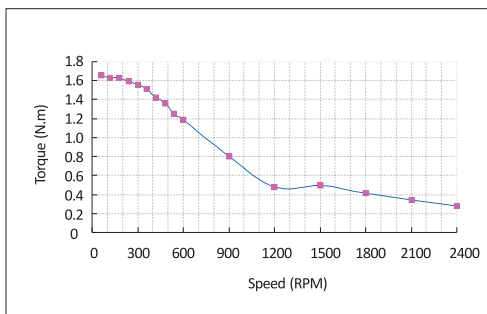

Stepper Motor: 57HS22
Stepper Drive: MD556
Input Voltage: 36 VDC

Output Current: 5.6 A(Peak)
Microstep: 2000 steps/rev.
Connection: Parallel


86HS45

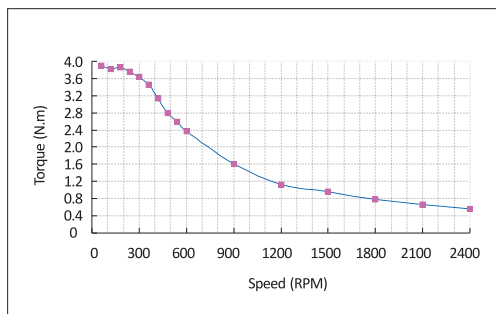

Stepper Motor: 86HS45
Stepper Drive: MD882
Input Voltage: 64 VDC

Output Current: 8.2 A(Peak)
Microstep: 2000 steps/rev.
Connection: Parallel


86HS85

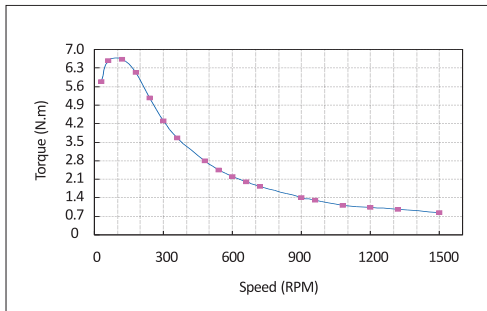

Stepper Motor: 86HS85
Stepper Drive: MD882
Input Voltage: 68 VDC

Output Current: 7.3 A (Peak)
Microstep: 3200 steps/rev.
Connection: Parallel

110HS20

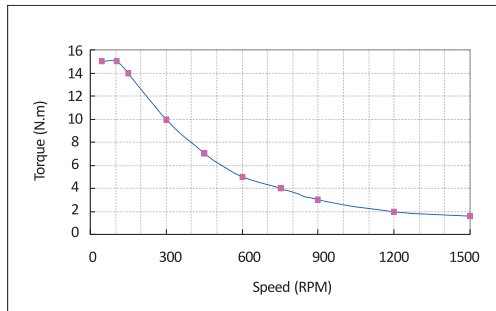


Stepper Motor: 110HS20
Stepper Drive: MD2278
Input Voltage: 110 VAC

Output Current: 7.8 A (Peak)
Microstep: 400 steps/rev.
Connection: Parallel

Speed-Torque Curves of 3-phase Stepper Motors


573S09

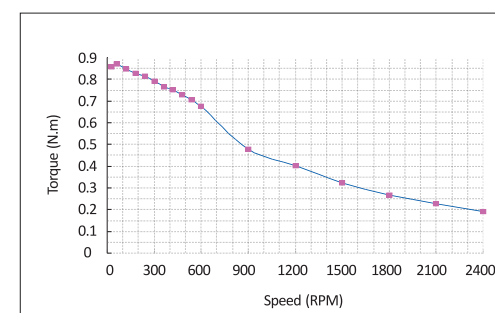

Stepper Motor: 573S09
Stepper Drive: 3MD560
Input Voltage: 36 VDC

Output Current: 4.9 A(Peak)
Microstep: 2000 steps/rev.
Connection: Delta


573S15

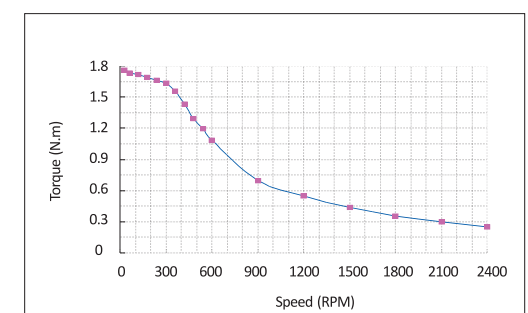

Stepper Motor: 573S15
Stepper Drive: 3MD560
Input Voltage: 36 VDC

Output Current: 7.7 A(Peak)
Microstep: 2000 steps/rev.
Connection: Delta


863S22

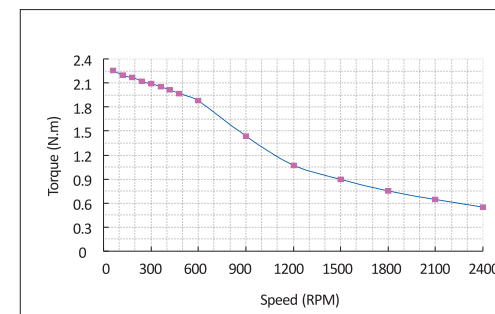

Stepper Motor: 863S22
Stepper Drive: 3ND883
Input Voltage: 64 VDC

Output Current: 6.6 A(Peak)
Microstep: 2000 steps/rev.
Connection: Delta


863S42

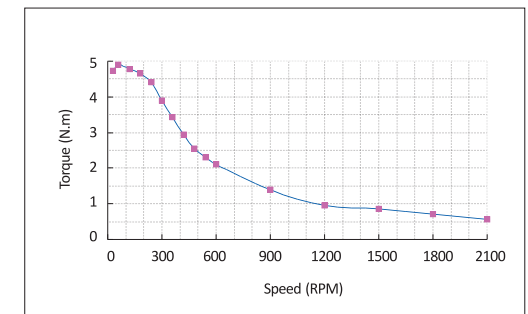

Stepper Motor: 863S42
Stepper Drive: 3ND883
Input Voltage: 64 VDC

Output Current: 7.4 A(Peak)
Microstep: 2000 steps/rev.
Connection: Delta

863S68H

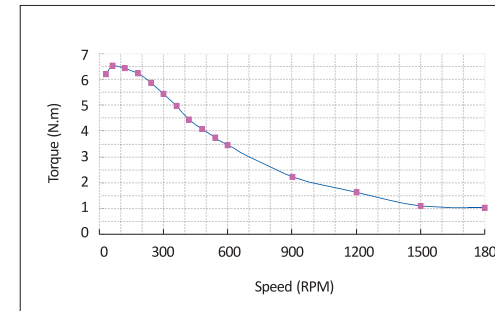


Stepper Motor: 863S68H
Stepper Drive: 3MD2380
Input Voltage: 220 VAC

Output Current: 3.36 A(Peak)
Microstep: 2000 steps/rev.
Connection: Delta

Integrated Steppers

(Open-loop Stepper Systems)


■ Motor + Drive + Controller + Network

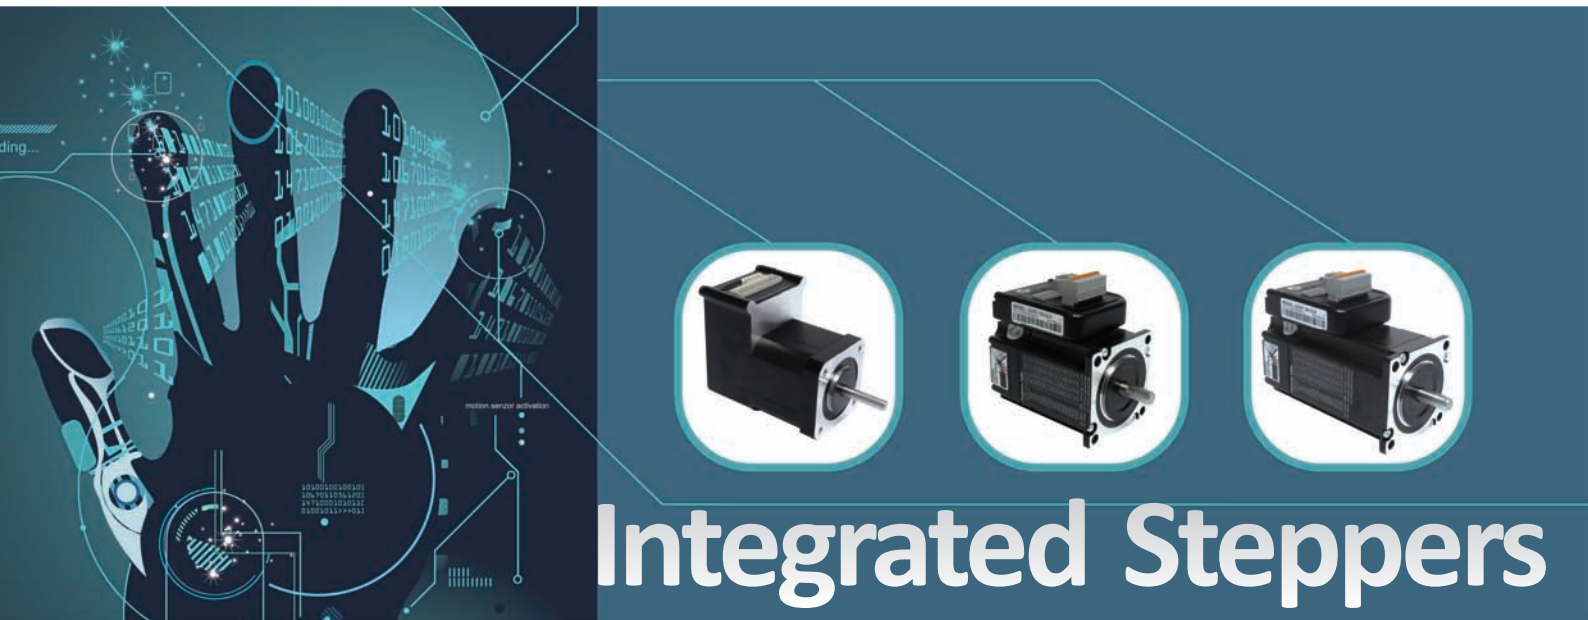

Integrated Steppers

iST Series (Open-loop Stepper Systems)

iST Series Integrated Steppers

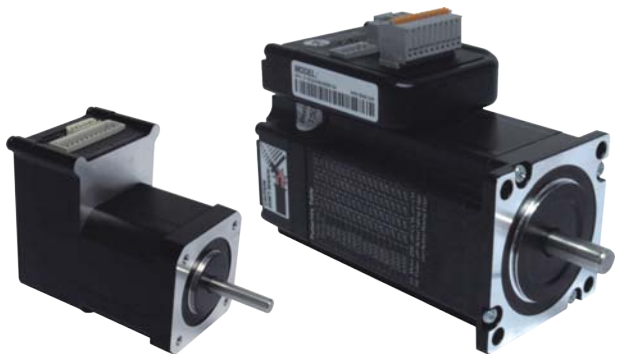

Features

- **Highly Integrated**, Stepper motor + advanced DSP stepper drive
- **Extra-low** motor noise
- **Anti-Resonance** optimizes torque and nulls mid-range instability
- **Multi-stepping** allows a low resolution input to produce a higher microstep output for smoother system performance
- Options to set output current and microstep resolutions via DIP switch or software
- Command input of PUL/DIR and CW/CCW
- Over-current, over-voltage, short-circuit protections



Introduction

Leadshine's iST series integrated steppers are one of the most compact stepper systems available on the market. An iST integrated stepper has a stepper motor and an advanced DSP stepper drive. At very compact size and with all components integrated, the iST series steppers can save mounting space, eliminate encoder connection and motor wiring time, reduce interference, and lower cable and labour cost. Owe to its advanced DSP stepper drive, the iST series integrated steppers offer high starting torque, high precision and smooth movement, and extra low noise at low speed movement with no obvious resonance area. The drive takes step & direction commands, and is capable of outputting fault signals back to the master controller or external devices for complete system controls.





The iST series integrated steppers are suitable for applications require compact size, smooth movement, and extra low noise stepper systems, such as medical devices, dental mills, lab automation instruments, etc.

Part Number

iST	-	<div>□□</div>	<div>□□</div>	-	<div>□</div>	-	<div>□□□</div>
iST: Integrated Stepper		Motor Frame Size 17: NEMA17 (42mm) 23: NEMA23 (57mm) 24: NEMA24 (60mm)	Holding Torque 03: 0.3 Nm 09: 0.9 Nm 20: 2.0 Nm ...		Communication Type Blank: Step & Direction R: RS485 C: CANopen		Custom or Special model number

Overview

iST-17
(NEMA17)

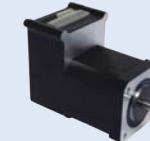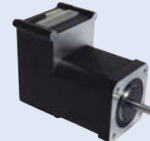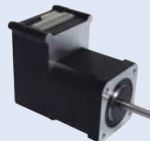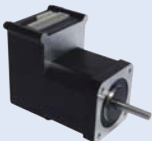



IST-1703

IST-1704

IST-1705

IST-1706





iST-23
(NEMA23)



IST-2309

IST-2320

iST-24
(NEMA24)



IST-2412

IST-2418

IST-2424

IST-2430


Specifications

Model		iST-17	iST-23	iST-24
Operating Voltage (VDC)		24	18 to 48	18 to 70
Holding Torque (Nm)		0.3, 0.4, 0.5 and 0.6	0.9 and 2.0	1.2, 1.8, 2.4 and 3.0
Operation Modes		Step & Direction, RS485 and CANopen		
Maximum Input Frequency (kHz)		500		
Protection Functions		Over-current, Over-voltage		
Inputs	Step & Direction	Step & Direction, Enable (differential)		
	RS485 / CANopen	4 digital inputs, 1 analog input (single-end)		
Outputs	Step & Direction	fault out (differential)		
	RS485 / CANopen	2 digital outputs (open collector)		
Storage Temperature		-20 °C to 80 °C		
Ambient Temperature		0 °C to 50 °C (Heat sink)		
Humidity		40%RH to 90%RH		

Please visit Leadshine's website at www.leadshine.com for the latest information about the iST series integrated steppers.


Operation Modes

1. Step & Direction

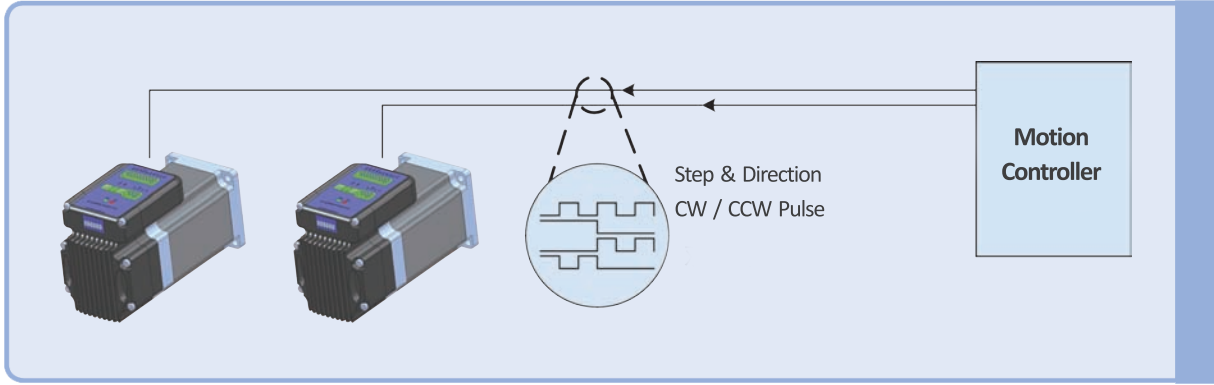


- Support step & direction and CW/CCW pulse commands
- Compatible with 5 to 24 V command signals

2. RS485

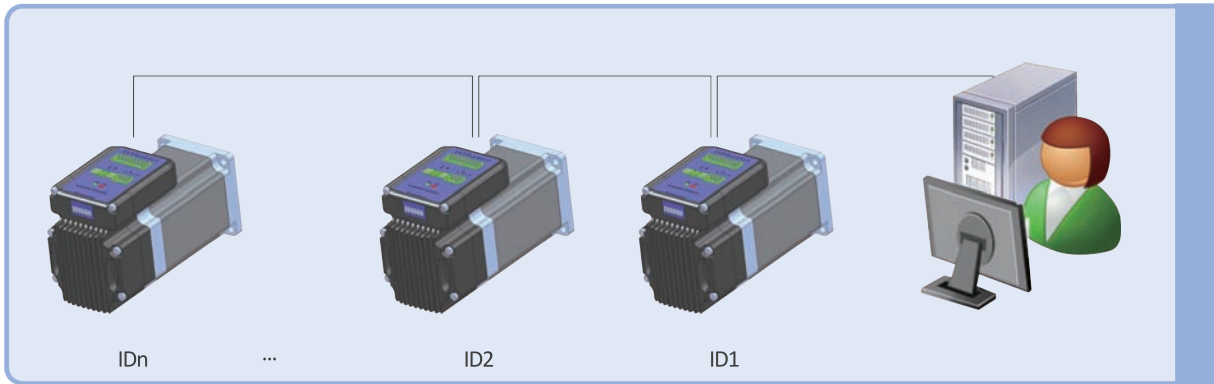

- One host up to 32 drives
- Can be used with either 2-wire (half-duplex) or 4-wire RS485 (full-duplex) implementation
- DLL is available for API function calling
- Easy to wire and build multi-axis systems


3. CANopen

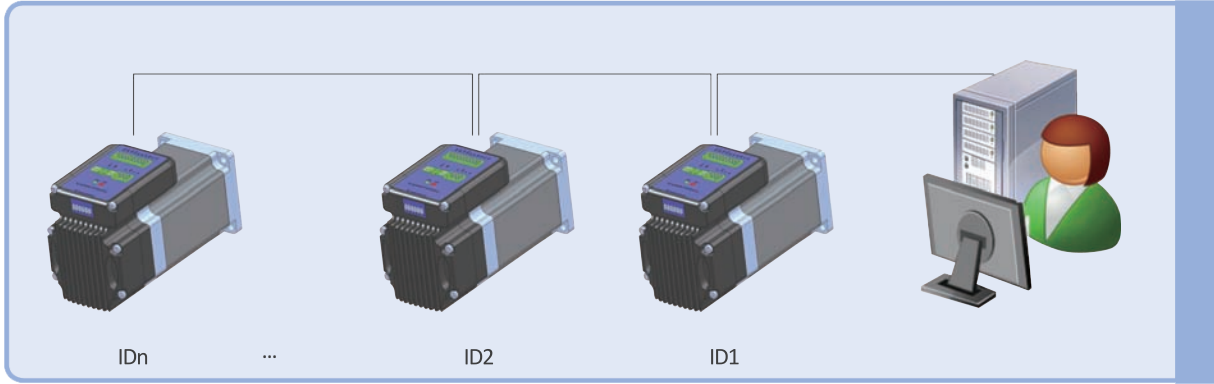


- One host up to 127 drives
- CANopen standards: CiA Standard 301 (DS301), CiA Standard 402 (DSP402)
- Up to 1 Mbit/sec speeds possible
- Easy to wire and build multi-axis systems

Typical System Configurations

1. Step & Direction

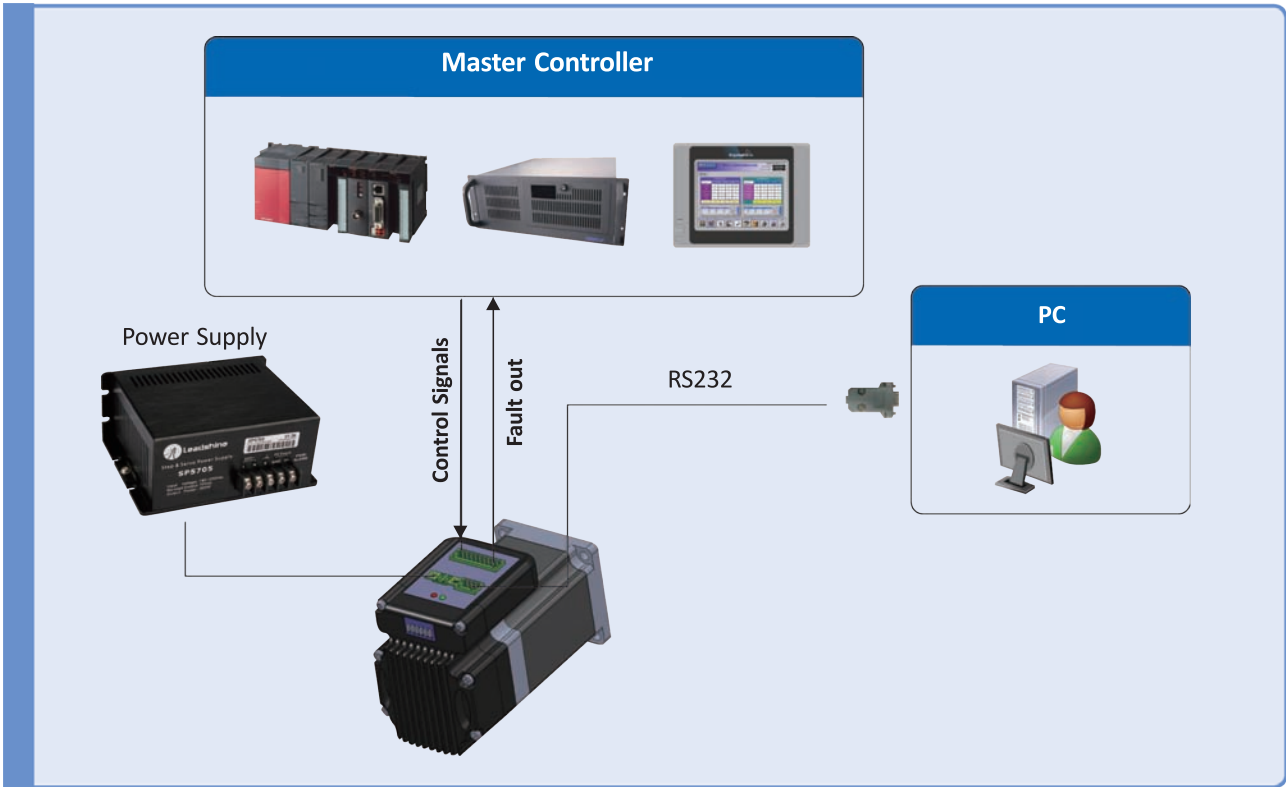


2. RS485 and CANopen

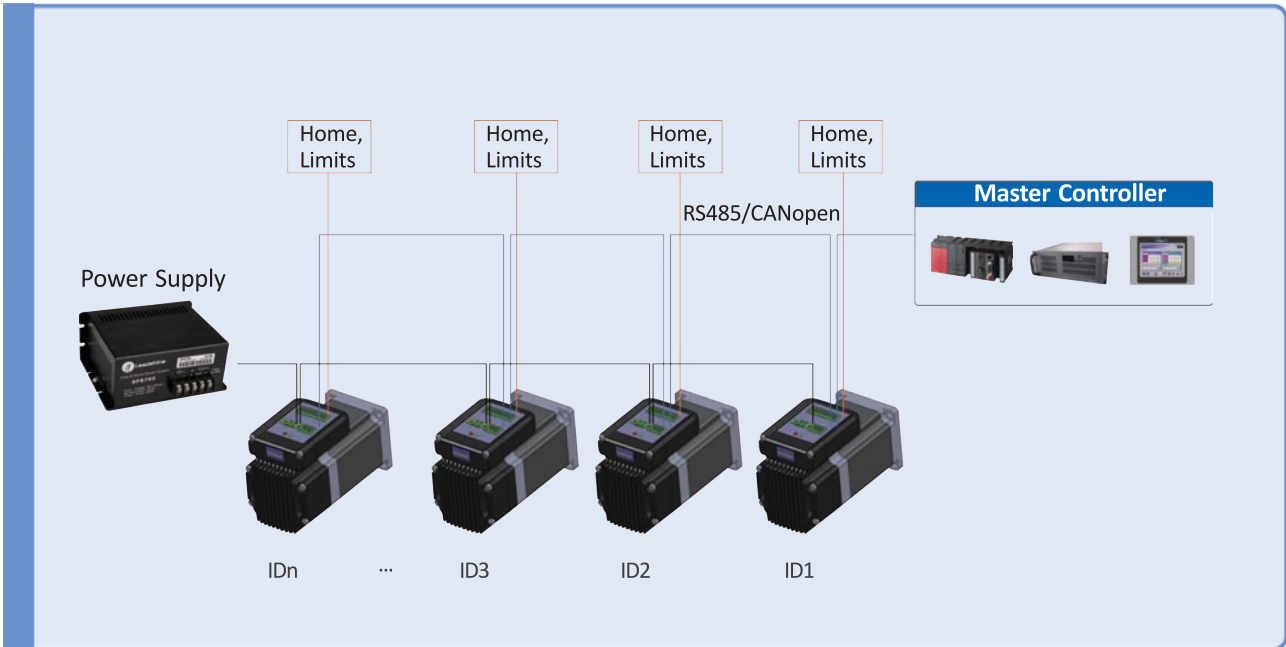

Pin Assignment


Model	Step&Direction	RS485	CANopen
iST-17	+5V TX GND RX GND	T+ T- R+ R- GND	CANH CANL CANH CANL GND
iST-23			
iST-24			

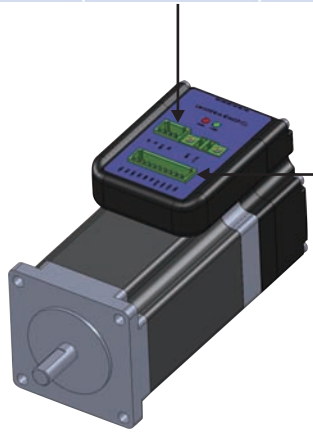


Model	Step&Direction	RS485/ CANopen
iST-17	PUL+ PUL- DIR+ DIR- ENA+ ENA- PEND+ PEND- ALM+ ALM- +VDC GND	IN1 IN2 IN3 IN4 OUT1 OUT2 VIN+ VIN- COM+ COM- +VDC GND
iST-23		
iST-24		

Speed-Torque Curves


Model: iST-1703, Resolution:3200steps/rev., Peak Current: 1.4 A

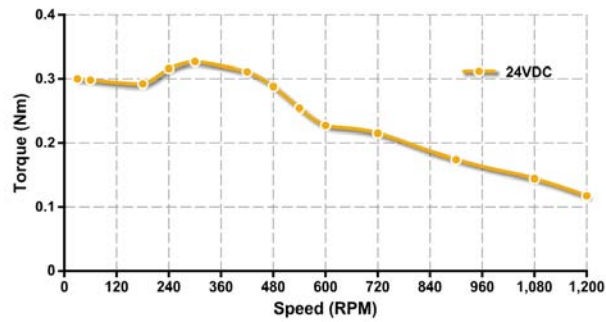


Model: iST-1706, Resolution:1600steps/rev., Current: Maximum

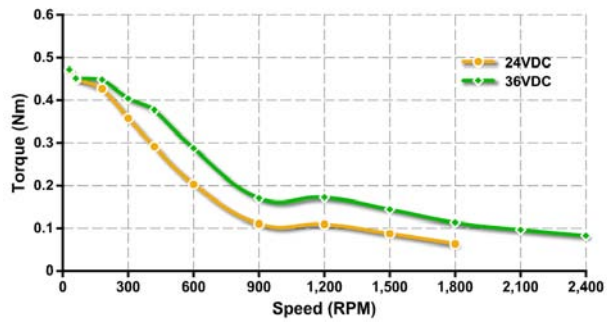

Model: iST-2309, Resolution: 1600steps/rev., Current: Maximum

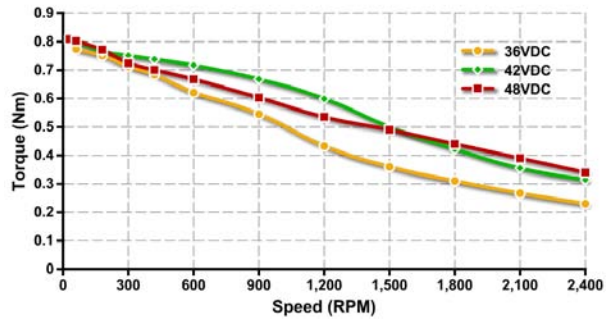


Model: iST-2320, Resolution:1600steps/rev., Current: Maximum

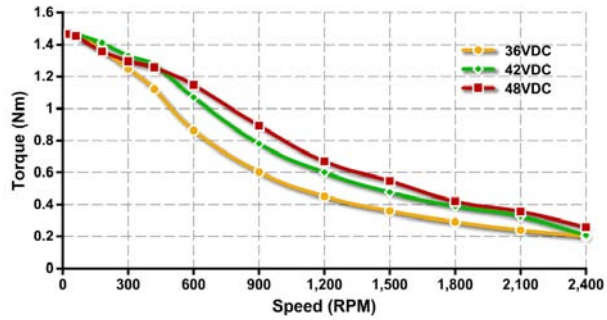


* Please contact Leadshine or visit www.leadshine.com for more speed-torque curves of other models.

Mechanical Specifications

iST-17

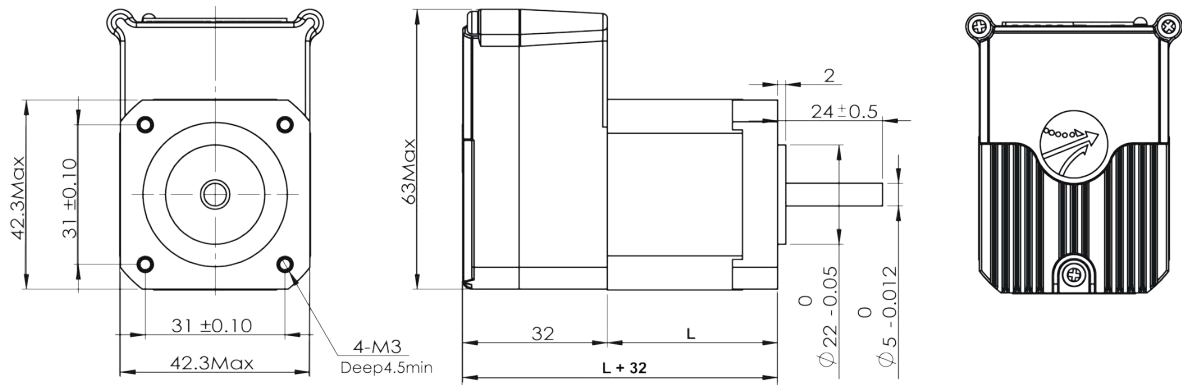

iST-23

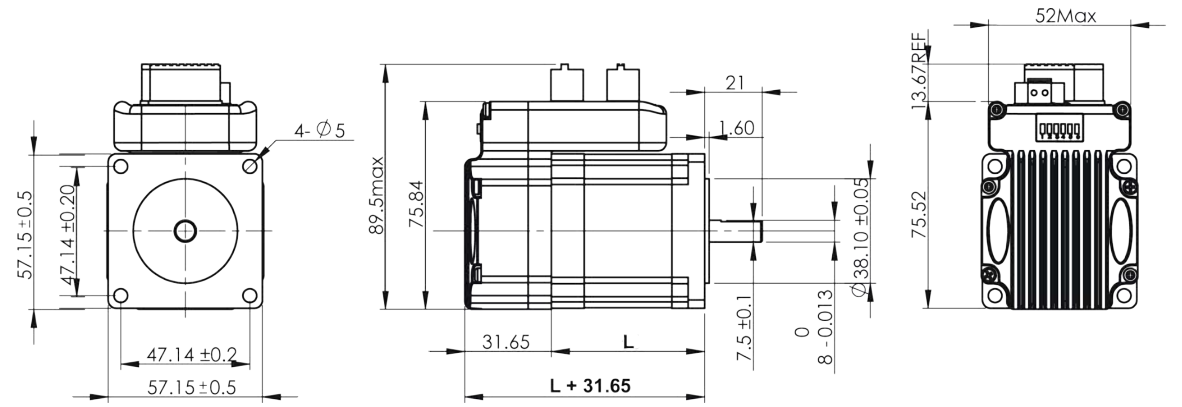

Frame Size	Motor Body Length (mm)	Holding Torque (Nm)	Model
iST-17 (NEMA17)	L = 33	0.3	iST-1703-x
	L = 39	0.4	iST-1704-x
	L = 47	0.5	iST-1705-x
	L = 58	0.6	iST-1706-x
iST-23 (NEMA23)	L = 56	1.0	iST-2309-x
	L = 80	2.0	iST-2320-x
iST-24 (NEMA24)	L = 47	1.2	iST-2412-x
	L = 55	1.8	iST-2418-x
	L = 68	2.4	iST-2424-x
	L = 85	3.0	iST-2430-x

Companion Products

Stepper and Servo Power Supplies

SPS Series Unregulated Switching Mode Power Supplies

- Specifically designed to power stepper and servo drives
- High efficiency, compact size, light weight
- Input voltage 220VAC± 10% or 110VAC± 10% 50/60 Hz
- Short circuit, over-current, over-voltage and short-voltage protection



Electrical Specifications					
Model	Output Voltage (V)	Output Current (A)	Input Voltage	Size (mm)	Weight (kg)
SPS407	42	7 (RMS)	220VAC± 10%	132*104*60	0.638
SPS487	48	7 (RMS)			
SPS705	68	5 (RMS)			
SPS407-L	42	4.7 (RMS)	110VAC± 10%	132*104*60	0.638
SPS487-L	48	4.0 (RMS)			
SPS705-L	68	3.0 (RMS)			

RPS Series Regulated Switching Mode Power Supplies

- Specifically designed to power stepper and servo drives
- High efficiency, compact size, light weight
- Input voltage 220VAC± 10% or 110VAC± 10% 50/60 Hz
- Short circuit, over-current, over-voltage and short-voltage protection



Electrical Specifications					
Model	Output Voltage (V)	Output Current (A)	Input Voltage	Size (mm)	Weight (kg)
RPS2410	24	10 (RMS)	220VAC±10% or 110VAC±10%	199*110*50	0.8
RPS369	36	9.7 (RMS)		215*113.6*50	0.88
RPS488	48	8.3 (RMS)		215*113.6*50	0.88
RPS608	60	8.5 (RMS)		261*102.4*65	1.13

PS Series Linear Power Supplies


- Low cost and high reliability
- 3 main output plus 1 auxiliary output
- Short circuit and over-voltage protection
- Simple structure



Electrical Specifications					
Model	Main DC Output	Auxiliary DC Output	Rated Power	Size (mm)	Weight (kg)
PS405-5	DC36V/5A	DC5V/1A	200	175*110*70	1.6
PS405-12	DC36V/5A	DC12V/1A	200		
PS408-5	DC36V/8A	DC5V/1A	300		
PS408-12	DC36V/8A	DC12V/1A	300		
PS804-5	DC68V/4A	DC5V/1A	300	175*110*70	2.0
PS804-12	DC68V/4A	DC12V/1A	300		
PS806-5	DC68V/6A	DC5V/1A	500	215*130*70	3.5
PS806-12	DC68V/6A	DC12V/1A	500		

Companion Products

Motion Controllers

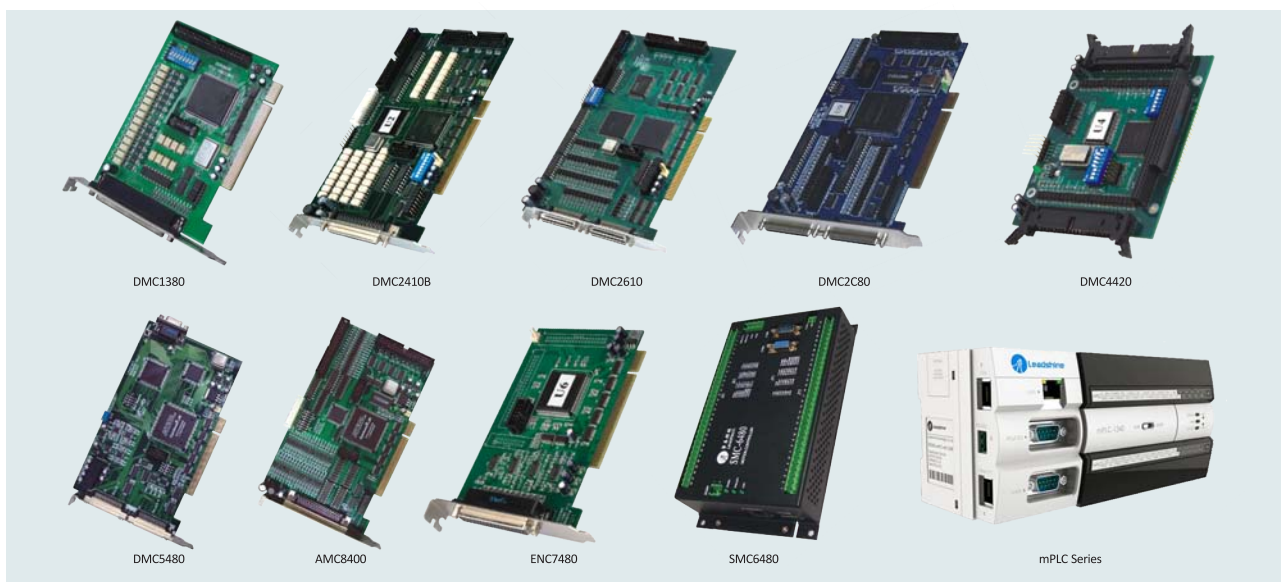

Introduction

A variety of controllers handle motion control today. Depending on the application, a bus-based, stand-alone, or network motion controller may be needed. There are three popular data communication technologies or protocols, are used in motion control: PC bus, such as peripheral component interconnect (PCI), fieldbus and Ethernet. Each has its place in industrial control .

PCI Bus.

PCI bus architecture offers the highest data transfer rate between peripheral devices and a PC — about 20 times greater than either Ethernet or fieldbus. There are several advantages to PC-based motion control including lower system cost, flexibility, continuous improvement of PC technology, easy to make an user-friendly software and ease of integration with other PC-based components, such as PC-based machine vision or data acquisition. A single platform can synchronize each of these pieces to one another, opening up new possibilities for automated inspection.

However, the PCI architecture offers only a bus-based approach. In applications where the motion controller has to handle functions independent of a PC or in cases where the machine doesn't have PC control, PCI architecture doesn't work. However, most fieldbus or Ethernet controllers can operate as stand-alone devices. Nevertheless, the trend toward integrating vision and motion system software can increase the use of the PC-based motion controllers among applications that need high-level precision.

Fieldbus.

Originally designed as a replacement for the 4-20mA analog control method, fieldbus is a generic term that covers many different industrial network protocols. Two of the most popular protocols are CANopen, EtherCAT, DeviceNet and Profibus. Generally, fieldbus protocols originate with specific programmable logic controller (PLC) manufacturers, and their performance and hardware interfaces differ. Software is a key component in the fieldbus standard, and such equipment often required custom software to make the systems work.

Ethernet.

Ethernet offers a variety of advantages for today's motion control needs. It's usually incorporated into a motion control system through a stand-alone controller connected to the PC or network using a standard Ethernet cable.

Using Ethernet TCP/IP can help eliminate the problems inherent with PCI architecture. Ethernet devices are stand-alone and outside the PC. And another important advantage of the Ethernet protocol is its inherent scalability.

Most supervisory control and data acquisition (SCADA) networks use TCP/IP over Ethernet as the network protocol and physical layer. If a motion controller must connect to a factory network through a network interface, Ethernet motion controller is a good choice.

Typical Controller Features

Controllers generate several types of motion profiles including point-to-point, linear/circular interpolation, and contouring.

Point-to-point motion is the most basic type of controlled motion. As the name implies, an axis is made to move from one position to another. Point-to-point motion is used in applications where complex trajectories are not important such as moving a slide to a certain position or indexing a conveyor belt.

Linear interpolation extends the point-to-point approach to include coordinated motion between two or more axes. Linear interpolation specifies a target destination in two or three dimensional space. Axes move in concert plotting a direct path to the specified destination.

Circular interpolation also involves coordination of multiple axes. Circular interpolation is a hardware feature of many controllers that creates smooth circular paths without chordal error by connecting several short linear moves or chords. The combination of circular and linear interpolation enables the creation of many complex trajectories.

Some paths, however, can not be defined using simple lines and arcs. Such complex paths require controllers that support contouring. Contouring can be used for special applications like complex CNC machining, earthquake simulation.

Leadshine's Motion Controllers

Since releasing its first motion controller in 1997, Leadshine has been developing new products to meet the needs of its customers in a wide range of industries. Today, thousands of Leadshine motion controllers are deployed around the world in hundreds of industries. These applications include PCB drilling and milling machines, coordinate measuring machines (CMM), laser welding machines, vision and photo composition automation, electronic manufacturing and assembly, measurement device, biotech sampling and handing, LCD manufacturing, robotics, electronic assembly and measurement equipment, AOI machines, screen printing machines, and so on.


Leadshine is distinguished from others by providing motion controllers that are highly reliable, cost-effective, and easy-to-use. Leadshine's full line of motion controllers includes single and multi-axis, bus-based and stand-alone controllers. Available interface options for international markets include PCI bus, Ethernet, CANopen, EtherCAT, USB and RS232/RS485, etc. By using advanced microcomputer, Leadshine's controllers provide high speed performance and can handle many modes of motion such as point-to-point positioning, jogging, linear and circular interpolation, continuous interpolation and helix interpolation.

All of them are SMT processed with high reliability. They are suitable for stepping and digital servo control systems. Leadshine offers drivers, demo software, and documents to help the users to develop their own application software with G code or VB/VC/C++ Builder/LabVIEW in Window95/98/2000/NT/XP/7.


Selection Table (visit www.leadshine.com for information about other motion controllers.)

Model	DMC1000B	DMC2410B	DMC5480	SMC6480	mPLC Series	ENC7480
Features						
Number of Controllable Axes	4	4	4	4	up to 32	4
Interfaces	PCI	PCI	PCI	Stand-alone Ethernet, RS232, USB	Stand-alone CANopen, EtherCAT	PCI
Pulse Output Frequency (Max)	1.2 MPPS	5 MPPS	8.0 MPPS	5.0 MPPS	500 KPPS	-
Encoder Input Frequency (Max)	-	4 MHz	6 MHz	-	-	6.5 MHz
Position Ranges	24-bit ± (8,388,608 pulses)	28-bit ± (134,217,728 pulses)	28-bit ± (134,217,728 pulses)	32-bit ± (2,147,483,648 pulses)	32-bit ± (2,147,483,648 pulses)	-
General purpose I/O	32 Inputs / 28 Outputs	20 Inputs / 20 Outputs	20 Inputs / 20 Outputs	32 Inputs / 24 Outputs	optional and expandable	32 Inputs / 32 Outputs
Linear Interpolation	2~4 axes	2~4 axes	2~4 axes	2~4 axes	2~4 axes	-
Circular Interpolation	Any 2 axes Software Interpolation	Any 2 axes High Speed Hardware Interpolation	Any 2 axes High Speed Hardware Interpolation	Any 2 axes High Speed Hardware Interpolation	Any 2 axes Software Interpolation	-
Continuous Interpolation	-	Yes	Yes	Yes	Yes	-
Acceleration and Deceleration	Equal	Equal or Unequal	Equal or Unequal	Equal or Unequal	Equal or Unequal	-
Encoder Counter	-	28-bit ± (134,217,728 pulses)	32-bit ± (2,147,483,647 pulses)	28-bit ± (134,217,728 pulses)	-	28-bit ± (134,217,728 pulses)
Manual Pulser Input	-	100 KHz (Max)	100 KHz (Max)	100 KHz (Max)	-	-
Index Signal Input	-	Yes	Yes	Yes	-	Yes

Part Number

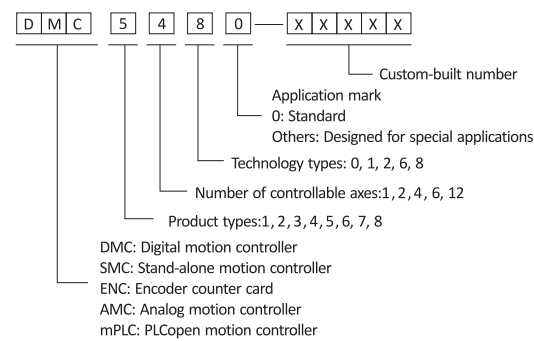

Typical motion control system (1 axis)

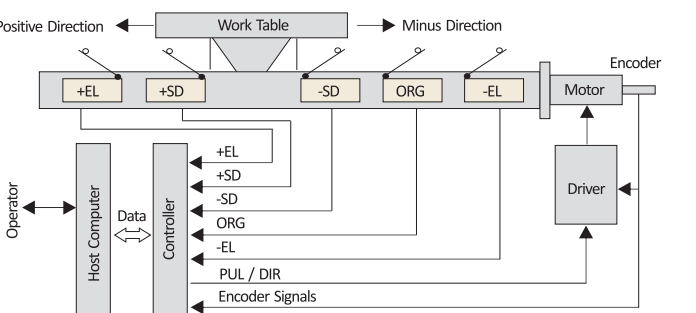

Notes

Notes